



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: N/A Cross Street: RED_HILL_AVE Location: N

ADA ID: RPRK220107120151 Ramp Type: Type 7 - Directional 2 Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 15

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

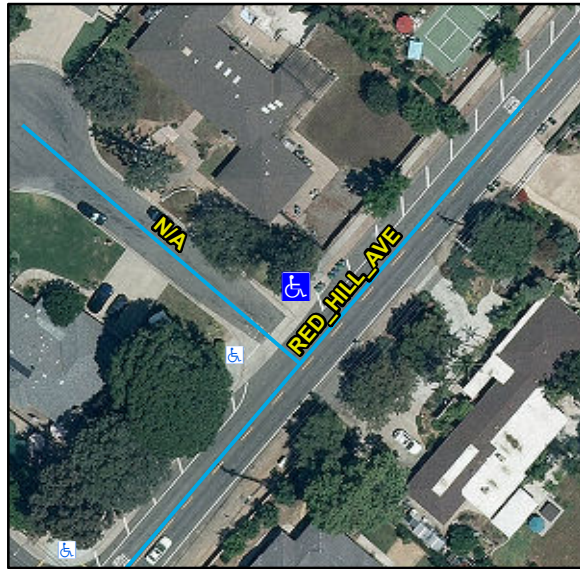

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Grind Gutter Lip.

Surveyor Notes:

N/A

OC Std/PROW:

R204.3, R304.2.2, R302.7.2, STD 1115

Total Cost: \$ 3230

Parcel ID Number 502-131-41
Ramp Island Or Median None
Ramp Orientation Diag
Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.7535612,-117.79557698

Street 1 Name N/A
Stop Condition-Street 1 StopSign
Street 2 Name RED_HILL_AVE
Stop Condition-Street 2 NoControl

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	N/A
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	70	N/A	Flare Type LT	
Yes	Ramp Width (in)	75			N/A
No	Ramp Run Slope (%)	9.9	N/A	Flare Slope LT (%)	N/A
Yes	Ramp Cross Slope (%)	0.4	N/A	Flare Traversable LT	N/A
N/A	Grade Break	N/A	N/A	Flare Type RT	
N/A	Grade Break Slope (%)	N/A			N/A
N/A	Grade Break Cross Slope (%)	N/A	N/A	Flare Slope RT (%)	N/A
	Addl Para Ramp Left?	No	N/A	Flare Traversable RT	N/A
	Addl Para Ramp Right?	No	N/A	DWS Provided	N/A
N/A	Landing Present	N/A	N/A	DWS Contrast	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Full Width	N/A
N/A	Landing Run Slope (%)	N/A		DWS Offset Type	N/A
N/A	Landing Cross Slope (%)	N/A	N/A	DWS Left Offset (in)	N/A
N/A	Landing Movement Obstructed?	N/A	N/A	DWS Right Offset (in)	N/A
	Landing Movement Type	N/A			
N/A	Landing Shared	N/A			
N/A	Marked Crosswalk 1	No	N/A	Clear Space	Yes
	Crossing 1 Direction	SW	N/A	Clear Space To Crosswalk (in)	N/A
	Marked Crosswalk 1 Width (in)	N/A			
N/A	Ramp Inside Crosswalk 1	N/A			
	Crossing 1 Slope (%)	2.2			
	Crossing 1 Cross Slope (%)	0.7			
N/A	Gutter Ponding	N/A	N/A	Curb Slope	4.2
No	Gutter Lip Height (in)	0.25		Road Run Slope (%)	0.6
N/A	Gutter Run Slope (%)	N/A		Road Cross Slope (%)	0.8
N/A	Gutter Cross Slope (%)	N/A		Parallel Ramp Side	Left
Yes	Overall Surface Condition	Acceptable	No	Perp Joint Present	No
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No

