



Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: LA_COLINA_DR		Cross Street: RED_HILL_AVE		Location:	S
ADA ID: RPRK220107121039	Ramp Type: Type 7 - Directional 2	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score:	2
Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		



Possible Solutions:

Remove & Replace Entire Ramp. Grind Gutter Lip.

Surveyor Notes:

N/A

OC Std/PROW:

R304.5.3, R302.7.2, STD 1115


Total Cost: \$ 3230

Parcel ID Number	103-174-11	Street 1 Name	LA_COLINA_DR
Ramp Island Or Median	None	Stop Condition-Street 1	StopSign
Ramp Orientation	NonDiag	Street 2 Name	RED_HILL_AVE
Google Street View Link:		Stop Condition-Street 2	N/A

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.75011359,-117.79874353

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	N/A
	Obstruction Dimensions	N/A			N/A

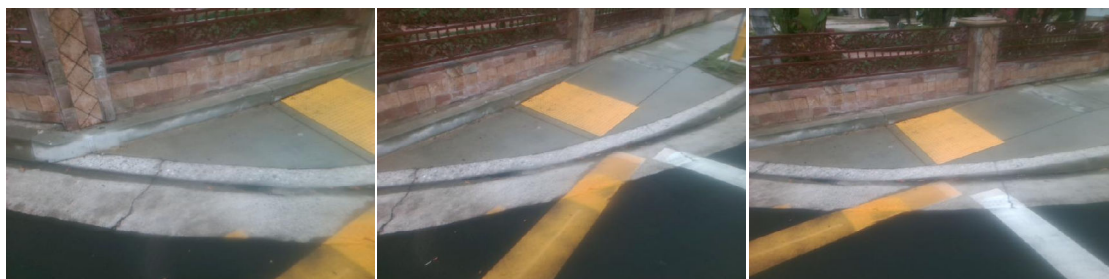

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	160	N/A	Flare Type LT	
Yes	Ramp Width (in)	48			N/A
Yes	Ramp Run Slope (%)	7.2	N/A	Flare Slope LT (%)	N/A
No	Ramp Cross Slope (%)	2.3	N/A	Flare Traversable LT	N/A
N/A	Grade Break	N/A	N/A	Flare Type RT	
N/A	Grade Break Slope (%)	N/A			N/A
N/A	Grade Break Cross Slope (%)	N/A	N/A	Flare Slope RT (%)	N/A
	Addl Para Ramp Left?	No	N/A	Flare Traversable RT	N/A
	Addl Para Ramp Right?	No	N/A	DWS Provided	N/A
N/A	Landing Present	N/A	N/A	DWS Contrast	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Full Width	N/A
N/A	Landing Run Slope (%)	N/A		DWS Offset Type	N/A
N/A	Landing Cross Slope (%)	N/A	N/A	DWS Left Offset (in)	N/A
N/A	Landing Movement Obstructed?	N/A	N/A	DWS Right Offset (in)	N/A
	Landing Movement Type	N/A			
N/A	Landing Shared	N/A			
N/A	Marked Crosswalk 1	Yes	N/A	Clear Space	N/A
	Crossing 1 Direction	NE	N/A	Clear Space To Crosswalk (in)	N/A
	Marked Crosswalk 1 Width (in)	144			
N/A	Ramp Inside Crosswalk 1	Yes			
	Crossing 1 Slope (%)	2.6			
	Crossing 1 Cross Slope (%)	0.2			
N/A	Gutter Ponding	N/A	N/A	Curb Slope	3.5
No	Gutter Lip Height (in)	0.25		Road Run Slope (%)	N/A
N/A	Gutter Run Slope (%)	N/A		Road Cross Slope (%)	N/A
N/A	Gutter Cross Slope (%)	N/A		Parallel Ramp Side	Left
Yes	Overall Surface Condition	Acceptable	Yes	Perp Joint Present	Yes
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A