




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: SANTA_CLARA_AVE		Cross Street: YORBA_ST		Location:	SE
ADA ID: RPRK220127120345	Ramp Type: Type 4 - Parallel	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score:	0
Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		

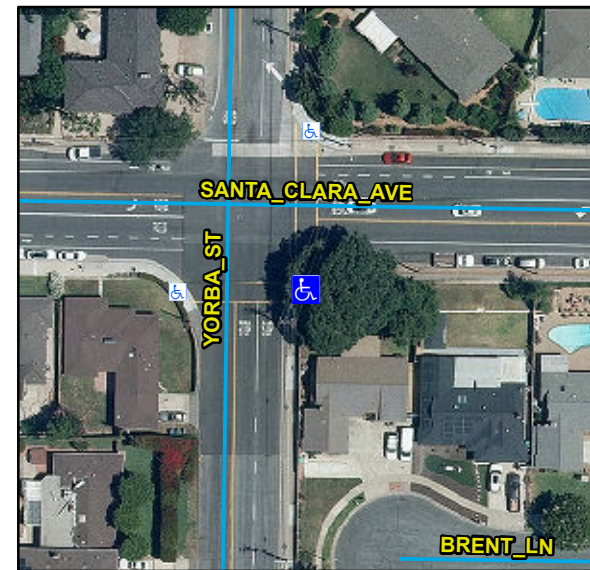

Possible Solutions:

Restripe Crosswalk.

Surveyor Notes:

N/A

OC Std/PROW:

R207.1, STD 1115

Total Cost: \$ 4000

Parcel ID Number	395-262-07	Street 1 Name	SANTA_CLARA_AVE
Ramp Island Or Median	None	Stop Condition-Street 1	StopSign
Ramp Orientation	Diag	Street 2 Name	YORBA_ST
Google Street View Link:		Stop Condition-Street 2	StopSign

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.76700028,-117.82692391

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	89	N/A	Ramp Length RT (in)	91
Yes	Ramp Width LT (in)	86	Yes	Ramp Width RT (in)	86
Yes	Ramp Run Slope LT (%)	5.7	Yes	Ramp Run Slope RT (%)	2.2
Yes	Ramp Cross Slope LT (%)	1.1	Yes	Ramp Cross Slope RT (%)	0.5
N/A	Landing Present	Yes	Yes	DWS Provided	Yes
N/A	Landing Length (in)	86	Yes	DWS Contrast	Yes
Yes	Landing Width (in)	48	Yes	DWS Length (in)	36
Yes	Landing Run Slope (%)	1.3	Yes	DWS Full Width	Yes
Yes	Landing Cross Slope (%)	0.8		DWS Offset Type	Single
N/A	Landing Movement Obstructed?	No	Yes	DWS Offset Left (in)	1
	Landing Movement Type	Curb	Yes	DWS Offset Right (in)	N/A
N/A	Landing Shared	No			
Yes	Clear Space	Yes			
Yes	Clear Space To Crosswalk (in)	48			
N/A	Marked Crosswalk 1	Yes	N/A	Marked Crosswalk 2	Yes
	Crossing 1 Direction	N		Crossing 2 Direction	W
	Marked Crosswalk 1 Width (in)	144		Marked Crosswalk 2 Width (in)	144
Yes	Ramp Inside Crosswalk 1	Yes	No	Ramp Inside Crosswalk 2	No
	Crossing 1 Slope (%)	11.1		Crossing 2 Slope (%)	4.6
	Crossing 1 Cross Slope (%)	1.5		Crossing 2 Cross Slope (%)	5.1
Yes	Gutter Ponding	No	Yes	Curb Slope	5.1
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	2.1
Yes	Gutter Run Slope (%)	2.7		Road Cross Slope (%)	9.1
Yes	Gutter Cross Slope (%)	1.5	Yes	Perpendicular Joint Present	Yes
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A

