




# Access Compliance Report Public Rights-of-Way (Curb Ramps)



|                                         |                              |                         |                                         |                 |   |
|-----------------------------------------|------------------------------|-------------------------|-----------------------------------------|-----------------|---|
| Main Street: HAZARD_AVE                 |                              | Cross Street: BEACH_BLV |                                         | Location:       | S |
| ADA ID: RPRK220202122456                | Ramp Type: Type 4 - Parallel | Initial Pass/Fail: Pass | Overall Compliance: Yes                 | Severity Score: | 0 |
| Codes/Mitigation Info/Possible Solution |                              |                         | Field Measurements/Component Compliance |                 |   |

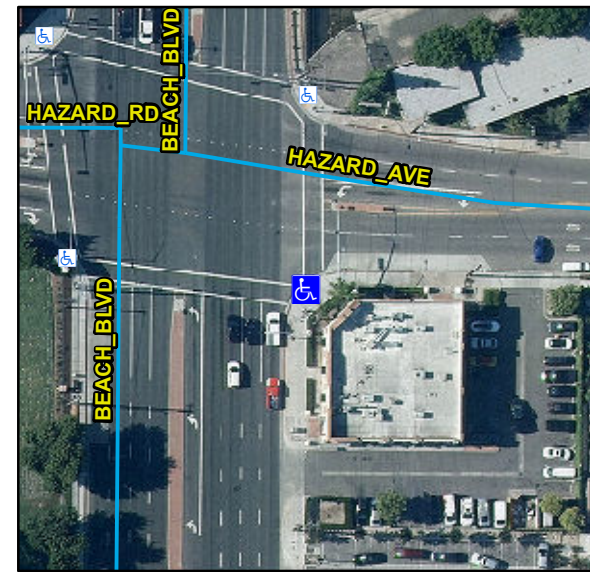

Possible Solutions:

N/A

Surveyor Notes:

N/A

OC Std/PROW:

N/A

Total Cost:

\$ 0

Parcel ID Number 097-101-63  
Ramp Island Or Median None  
Ramp Orientation Diag  
Google Street View Link:  
[http://www.google.com/maps/@?api=1&map\\_action=pano&viewpoint=33.75190823,-117.98934059](http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.75190823,-117.98934059)

Street 1 Name HAZARD\_AVE  
Stop Condition-Street 1 Signal  
Street 2 Name BEACH\_BLV  
Stop Condition-Street 2 Signal

## Obstruction and Utility Measurement/Component Compliance

| Compliance | Description            | Data | Compliance | Description        | Data |
|------------|------------------------|------|------------|--------------------|------|
| Yes        | Obstructions Present?  | No   | N/A        | Utilities Present? | No   |
|            | Obstruction Types      | N/A  |            | Utility Types      |      |
|            | Obstruction Dimensions | N/A  |            |                    | N/A  |

| Compliance | Description                   | Data       | Compliance | Description                   | Data   |
|------------|-------------------------------|------------|------------|-------------------------------|--------|
| N/A        | Ramp Length LT (in)           | 113        | N/A        | Ramp Length RT (in)           | 112    |
| Yes        | Ramp Width LT (in)            | 145        | Yes        | Ramp Width RT (in)            | 145    |
| Yes        | Ramp Run Slope LT (%)         | 2          | Yes        | Ramp Run Slope RT (%)         | 5.8    |
| Yes        | Ramp Cross Slope LT (%)       | 0.8        | Yes        | Ramp Cross Slope RT (%)       | 0.9    |
| N/A        | Landing Present               | Yes        | Yes        | DWS Provided                  | Yes    |
| N/A        | Landing Length (in)           | 145        | Yes        | DWS Contrast                  | Yes    |
| Yes        | Landing Width (in)            | 48         | Yes        | DWS Length (in)               | 36     |
| Yes        | Landing Run Slope (%)         | 1.6        | Yes        | DWS Full Width                | Yes    |
| Yes        | Landing Cross Slope (%)       | 0.5        |            | DWS Offset Type               | Single |
| N/A        | Landing Movement Obstructed?  | No         | Yes        | DWS Offset Left (in)          | 0      |
|            | Landing Movement Type         | Curb       | Yes        | DWS Offset Right (in)         | N/A    |
| N/A        | Landing Shared                | No         |            |                               |        |
| Yes        | Clear Space                   | Yes        |            |                               |        |
| Yes        | Clear Space To Crosswalk (in) | 48         |            |                               |        |
| N/A        | Marked Crosswalk 1            | Yes        | N/A        | Marked Crosswalk 2            | Yes    |
|            | Crossing 1 Direction          | NE         |            | Crossing 2 Direction          | NW     |
|            | Marked Crosswalk 1 Width (in) | 144        |            | Marked Crosswalk 2 Width (in) | 144    |
| Yes        | Ramp Inside Crosswalk 1       | Yes        | Yes        | Ramp Inside Crosswalk 2       | Yes    |
|            | Crossing 1 Slope (%)          | 5.3        |            | Crossing 2 Slope (%)          | 3.7    |
|            | Crossing 1 Cross Slope (%)    | 4.4        |            | Crossing 2 Cross Slope (%)    | 0      |
| Yes        | Gutter Ponding                | No         | Yes        | Curb Slope                    | 5.2    |
| Yes        | Gutter Lip Height (in)        | 0          |            | Road Run Slope (%)            | 1.1    |
| Yes        | Gutter Run Slope (%)          | 3.5        |            | Road Cross Slope (%)          | 4      |
| Yes        | Gutter Cross Slope (%)        | 0.6        | Yes        | Perpendicular Joint Present   | Yes    |
| Yes        | Overall Surface Condition     | Acceptable |            |                               |        |
|            | Cross Gutter Present?         | No         |            | Spandrel Present?             | No     |
|            | Replace Cross Gutter?         | N/A        |            | Replace Spandrel?             | N/A    |

