



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: BOLSA_AVE Cross Street: JACKSON_ST Location: NW

ADA ID: RPRK220202154038 Ramp Type: Type 4 - Parallel Initial Pass/Fail: Pass Overall Compliance: Yes Severity Score: 0

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

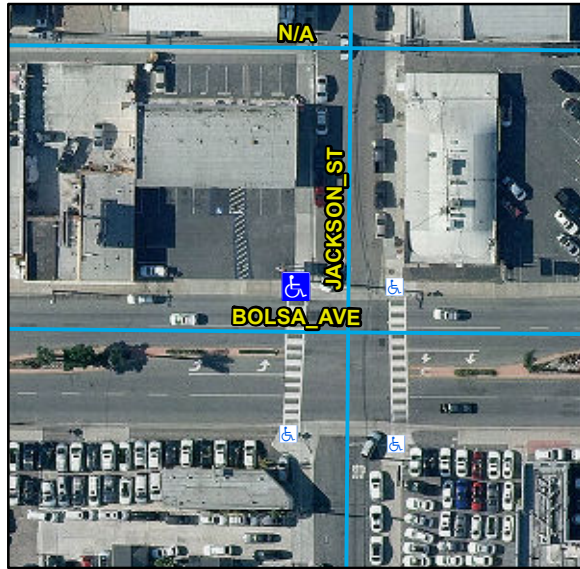

Possible Solutions:

Utility Present.

Surveyor Notes:

N/A

OC Std/PROW:

N/A

Total Cost:

\$ 0

Parcel ID Number 097-132-15

Ramp Island Or Median None

Ramp Orientation Diag

Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.74480432,-117.98754107

Street 1 Name BOLSA_AVE

Stop Condition-Street 1 NoControl

Street 2 Name JACKSON_ST

Stop Condition-Street 2 StopSign

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	Yes
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A		Power Pole	

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	68	N/A	Ramp Length RT (in)	74
Yes	Ramp Width LT (in)	88	Yes	Ramp Width RT (in)	111
Yes	Ramp Run Slope LT (%)	1.2	Yes	Ramp Run Slope RT (%)	4.4
Yes	Ramp Cross Slope LT (%)	0.4	Yes	Ramp Cross Slope RT (%)	0.3
N/A	Landing Present	Yes	Yes	DWS Provided	Yes
N/A	Landing Length (in)	88	Yes	DWS Contrast	Yes
Yes	Landing Width (in)	48	Yes	DWS Length (in)	36
Yes	Landing Run Slope (%)	0.4	Yes	DWS Full Width	Yes
Yes	Landing Cross Slope (%)	0.7		DWS Offset Type	Single
N/A	Landing Movement Obstructed?	No	Yes	DWS Offset Left (in)	0
	Landing Movement Type	Curb	Yes	DWS Offset Right (in)	N/A
N/A	Landing Shared	No			
N/A	Clear Space	Yes			
N/A	Clear Space To Crosswalk (in)	48			
N/A	Marked Crosswalk 1	Yes	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	S		Crossing 2 Direction	E
	Marked Crosswalk 1 Width (in)	120		Marked Crosswalk 2 Width (in)	N/A
Yes	Ramp Inside Crosswalk 1	Yes	N/A	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	8.8		Crossing 2 Slope (%)	N/A
	Crossing 1 Cross Slope (%)	3.3		Crossing 2 Cross Slope (%)	N/A
Yes	Gutter Ponding	No	Yes	Curb Slope	2.3
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	2
Yes	Gutter Run Slope (%)	0.2		Road Cross Slope (%)	1.9
Yes	Gutter Cross Slope (%)	0.2	Yes	Perpendicular Joint Present	Yes
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No

