




# Access Compliance Report Public Rights-of-Way (Curb Ramps)



**Main Street: PURDY\_ST** **Cross Street: HAZARD\_AVE** **Location: NE**

**ADA ID: RPRK220203121510** **Ramp Type: Type 4 - Parallel** **Initial Pass/Fail: Fail** **Overall Compliance: No** **Severity Score: 2**

**Codes/Mitigation Info/Possible Solution** **Field Measurements/Component Compliance**

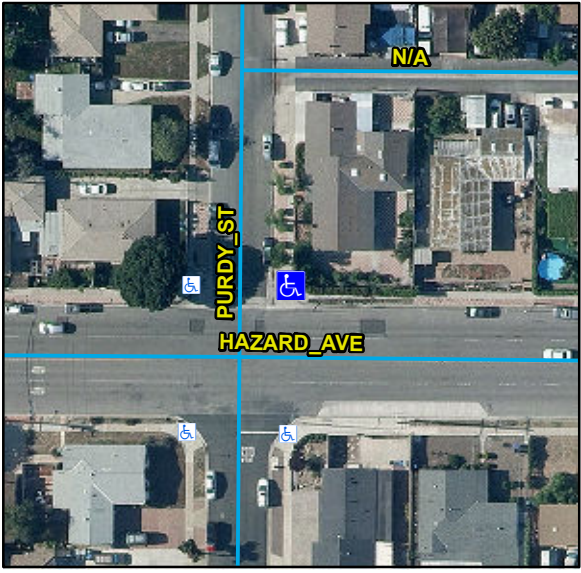

Possible Solutions:  
**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.**

Surveyor Notes:  
**N/A**

OC Std/PROW:  
**R204.3, R304.5.3, STD 1115**

Total Cost: **\$ 4000**

Parcel ID Number: **097-504-12**  
 Ramp Island Or Median: **None**  
 Ramp Orientation: **Diag**  
 Google Street View Link:  
[http://www.google.com/maps/@?api=1&map\\_action=pano&viewpoint=33.75219497,-117.97798164](http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.75219497,-117.97798164)

Street 1 Name: **PURDY\_ST**  
 Stop Condition-Street 1: **StopSign**  
 Street 2 Name: **HAZARD\_AVE**  
 Stop Condition-Street 2: **NoControl**

**Obstruction and Utility Measurement/Component Compliance**

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	111	N/A	Ramp Length RT (in)	124
Yes	Ramp Width LT (in)	102	Yes	Ramp Width RT (in)	102
Yes	Ramp Run Slope LT (%)	4.4	Yes	Ramp Run Slope RT (%)	7
No	Ramp Cross Slope LT (%)	2.8	No	Ramp Cross Slope RT (%)	3.5
N/A	Landing Present	N/A	N/A	DWS Provided	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Contrast	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Run Slope (%)	N/A	N/A	DWS Full Width	N/A
N/A	Landing Cross Slope (%)	N/A		DWS Offset Type	N/A
N/A	Landing Movement Obstructed?	N/A	N/A	DWS Offset Left (in)	N/A
	Landing Movement Type	N/A	N/A	DWS Offset Right (in)	N/A
N/A	Landing Shared	N/A			
N/A	Clear Space	Yes			
N/A	Clear Space To Crosswalk (in)	N/A			
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	W		Crossing 2 Direction	S
N/A	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	N/A	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	0.9		Crossing 2 Slope (%)	2.5
	Crossing 1 Cross Slope (%)	2.3		Crossing 2 Cross Slope (%)	0.9
N/A	Gutter Ponding	N/A	N/A	Curb Slope	1.4
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	0.4
N/A	Gutter Run Slope (%)	N/A		Road Cross Slope (%)	0
N/A	Gutter Cross Slope (%)	N/A	No	Perpendicular Joint Present	No
Yes	Overall Surface Condition	Acceptable		Spandrel Present?	Yes
	Cross Gutter Present?	Yes		Replace Spandrel?	No
	Replace Cross Gutter?	No			

