



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: N/A Cross Street: BEACH_BLVD Location: N

ADA ID: RPRK220203163737 Ramp Type: Type 7 - Directional 2 Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 10

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

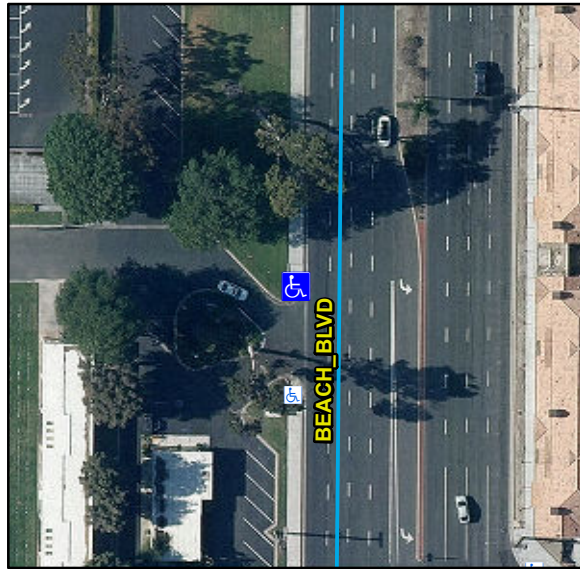

Possible Solutions:

Remove & Replace Entire Ramp. Remove & Replace Gutter.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.1, R305.2, R302.7, R304.5.4, STD 1115

Total Cost: \$ 3332

Parcel ID Number 096-370-35
Ramp Island Or Median None
Ramp Orientation NonDiag
Google Street View Link:

Street 1 Name N/A
Stop Condition-Street 1 NoControl
Street 2 Name BEACH_BLVD
Stop Condition-Street 2 N/A

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.74703462,-117.98971116

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	N/A
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	217	Yes	Flare Type LT	Curbed2
Yes	Ramp Width (in)	84			
Yes	Ramp Run Slope (%)	5.3	N/A	Flare Slope LT (%)	N/A
Yes	Ramp Cross Slope (%)	0.6	N/A	Flare Traversable LT	N/A
Yes	Grade Break	Yes	N/A	Flare Type RT	
Yes	Grade Break Slope (%)	0.5			None
Yes	Grade Break Cross Slope (%)	1.3	N/A	Flare Slope RT (%)	N/A
	Addl Para Ramp Left?	No	N/A	Flare Traversable RT	N/A
	Addl Para Ramp Right?	No	Yes	DWS Provided	Yes
N/A	Landing Present	Yes	Yes	DWS Contrast	Yes
No	Landing Length (in)	40	Yes	DWS Length (in)	108
Yes	Landing Width (in)	84	Yes	DWS Full Width	Yes
Yes	Landing Run Slope (%)	0.8		DWS Offset Type	Single
Yes	Landing Cross Slope (%)	1.2	No	DWS Left Offset (in)	39
N/A	Landing Movement Obstructed?	No	N/A	DWS Right Offset (in)	0
	Landing Movement Type	N/A			
N/A	Landing Shared	No			
N/A	Marked Crosswalk 1	No	N/A	Clear Space	N/A
	Crossing 1 Direction	S	N/A	Clear Space To Crosswalk (in)	N/A
	Marked Crosswalk 1 Width (in)	N/A			
N/A	Ramp Inside Crosswalk 1	N/A			
	Crossing 1 Slope (%)	0.5			
	Crossing 1 Cross Slope (%)	0.3			
No	Gutter Ponding	Yes	Yes	Curb Slope	2.1
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	N/A
No	Gutter Run Slope (%)	5.9		Road Cross Slope (%)	N/A
Yes	Gutter Cross Slope (%)	0.2		Parallel Ramp Side	Left
Yes	Overall Surface Condition	Acceptable	Yes	Perp Joint Present	Yes
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A

