



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: COVE_RD Cross Street: DANA_POINT_HARBOR_DR Location: NW

ADA ID: RPRK220208180604 Ramp Type: Type 1 - Perpendicular Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 2

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

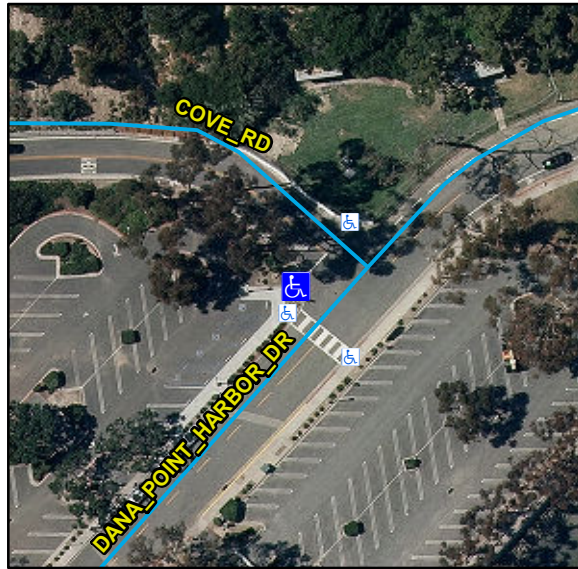

Possible Solutions:

Gutter Ponding Observed.

Surveyor Notes:

N/A

OC Std/PROW:

R302.7, STD 1115

Total Cost: \$ 252

Parcel ID Number 682-171-01

Ramp Island Or Median None

Ramp Orientation NonDiag

Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.46304525,-117.70642613

Street 1 Name COVE_RD

Stop Condition-Street 1 NoControl

Street 2 Name DANA_POINT_HARBOR_DR

Stop Condition-Street 2 N/A

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	50	Yes	Flare Type LT	
Yes	Ramp Width (in)	48			Curbed2
Yes	Ramp Run Slope (%)	2.8	N/A	Flare Slope LT (%)	N/A
Yes	Ramp Cross Slope (%)	1.1	N/A	Flare Traversable LT	N/A
N/A	Landing Present	Yes	Yes	Flare Type RT	
N/A	Landing Length (in)	57			Curbed2
Yes	Landing Width (in)	48	N/A	Flare Slope RT (%)	N/A
Yes	Landing Run Slope (%)	0.5	N/A	Flare Traversable RT	N/A
Yes	Landing Cross Slope (%)	1.5	Yes	DWS Provided	Yes
N/A	Landing Movement Obstructed?	No	Yes	DWS Contrast	Yes
	Landing Movement Type	N/A	Yes	DWS Length (in)	48
N/A	Landing Shared	No	Yes	DWS Full Width	Yes
N/A	Clear Space	N/A	Yes	DWS Offset Left (in)	0
N/A	Clear Space To Crosswalk (in)	N/A	Yes	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	N/A
	Crossing 1 Direction	E		Crossing 2 Direction	N/A
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	Yes	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	1.9		Crossing 2 Slope (%)	N/A
	Crossing 1 Cross Slope (%)	0.4		Crossing 2 Cross Slope (%)	N/A
No	Gutter Ponding	Yes	Yes	Curb Slope	0.5
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	N/A
Yes	Gutter Run Slope (%)	0.6		Road Cross Slope (%)	N/A
Yes	Gutter Cross Slope (%)	1.2			
Yes	Overall Surface Condition: Acceptable		Yes	Perp Joint Present	Yes
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A

