

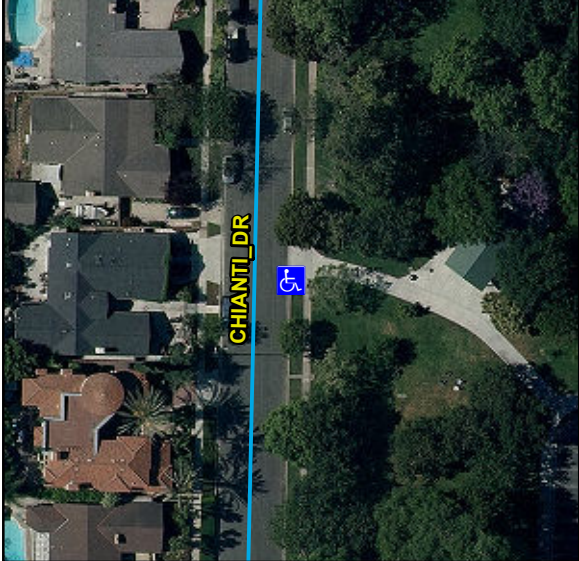


Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: CHIANTI_DR		Cross Street: CHIANTI_DR		Location:	E
ADA ID: RPRK220218145651	Ramp Type:Type 1 - Perpendicular	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score:	20

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
---	--	--	---	--	--

	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Entire Ramp. Remove & Replace Gutter.		N/A	Ramp Length (in)	84	N/A	Flare Type LT	
			Yes	Ramp Width (in)	235			Sloped
			Yes	Ramp Run Slope (%)	7.2	N/A	Flare Slope LT (%)	N/A
			Yes	Ramp Cross Slope (%)	0	N/A	Flare Traversable LT	No
	Surveyor Notes:		N/A	Landing Present	Yes	N/A	Flare Type RT	
				Landing Length (in)	48			Sloped
				Landing Width (in)	103	N/A	Flare Slope RT (%)	N/A
			No	Landing Run Slope (%)	4.3	N/A	Flare Traversable RT	No
			Yes	Landing Cross Slope (%)	0.9	No	DWS Provided	No
	OC Std/PROW:			Landing Movement Obstructed?	No	N/A	DWS Contrast	N/A
	R304.2.2-Perp, R304.3.2-Para, R305, R302.7.2, R304.5.4, STD 1115			Landing Movement Type	N/A	N/A	DWS Length (in)	N/A
			N/A	Landing Shared	No	N/A	DWS Full Width	N/A
			N/A	Clear Space	N/A	N/A	DWS Offset Left (in)	N/A
			N/A	Clear Space To Crosswalk (in)	N/A	N/A	DWS Offset Right (in)	N/A
	Total Cost:		\$	3332		N/A	Marked Crosswalk 1	No
						N/A	Marked Crosswalk 2	N/A
							Crossing 1 Direction	W
							Crossing 2 Direction	N/A
							Marked Crosswalk 1 Width (in)	N/A
						N/A	Marked Crosswalk 2 Width (in)	N/A
						N/A	Ramp Inside Crosswalk 1	N/A
						Yes	Ramp Inside Crosswalk 2	N/A
							Crossing 1 Slope (%)	4.8
							Crossing 2 Slope (%)	N/A
							Crossing 1 Cross Slope (%)	0
							Crossing 2 Cross Slope (%)	N/A
						Yes	Gutter Ponding	No
						Yes	Curb Slope	0.9
							Road Run Slope (%)	N/A
							Road Cross Slope (%)	N/A
							Gutter Run Slope (%)	5.8
							Gutter Cross Slope (%)	0.2
						Yes	Overall Surface Condition: Acceptable	Yes
							Perp Joint Present	Yes
							Cross Gutter Present?	No
							Spandrel Present?	No
							Replace Cross Gutter?	N/A
							Replace Spandrel?	N/A

Parcel ID Number	086-253-01	Street 1 Name	CHIANTI_DR
Ramp Island Or Median	None	Stop Condition-Street 1	NoControl
Ramp Orientation	NonDiag	Street 2 Name	CHIANTI_DR
Google Street View Link:		Stop Condition-Street 2	N/A
http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.78368033,-118.08264323			

Obstruction and Utility Measurement/Component Compliance			
Compliance	Description	Data	
Yes	Obstructions Present?	No	N/A
	Obstruction Types	N/A	
	Obstruction Dimensions	N/A	
	Utilities Present?	No	
	Utility Types		
		N/A	

