



Access Compliance Report

Public Rights-of-Way

(Curb Ramps)




Main Street: **ORANGE_AVE** Cross Street: **S_BROOKHURST_ST** Location: **SE**

ADA ID: **RPRK220218195300** Ramp Type: **Type 4 - Parallel** Initial Pass/Fail: **Pass** Overall Compliance: **No** Severity Score: **10**

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

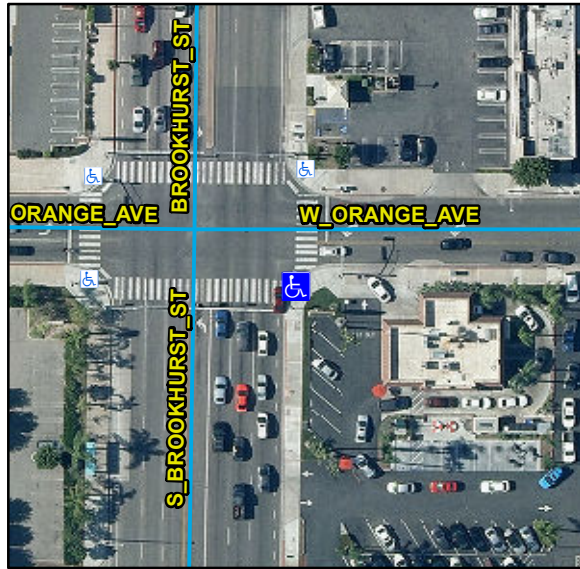

Possible Solutions:

**Remove & Replace Detectable Warning System.
Remove & Replace Gutter.**

Surveyor Notes:

N/A

OC Std/PROW:

R305.1.4, R305.2, R304.5.4, STD 1115

Total Cost: \$ **1052**

Parcel ID Number **128-181-01**
Ramp Island Or Median **None**
Ramp Orientation **Diag**
Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.82494934,-117.95875222

Street 1 Name **ORANGE_AVE**
Stop Condition-Street 1 **Signal**
Street 2 Name **S_BROOKHURST_ST**
Stop Condition-Street 2 **Signal**

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	105	N/A	Ramp Length RT (in)	84
Yes	Ramp Width LT (in)	108	Yes	Ramp Width RT (in)	108
Yes	Ramp Run Slope LT (%)	5.7	Yes	Ramp Run Slope RT (%)	7.1
Yes	Ramp Cross Slope LT (%)	0.2	Yes	Ramp Cross Slope RT (%)	1.1
N/A	Landing Present	Yes	Yes	DWS Provided	Yes
N/A	Landing Length (in)	105	Yes	DWS Contrast	Yes
Yes	Landing Width (in)	48	Yes	DWS Length (in)	36
Yes	Landing Run Slope (%)	1.4	No	DWS Full Width	No
Yes	Landing Cross Slope (%)	0.6		DWS Offset Type	Single
N/A	Landing Movement Obstructed?	No	No	DWS Offset Left (in)	4
	Landing Movement Type	Curb	No	DWS Offset Right (in)	N/A
N/A	Landing Shared	No			
Yes	Clear Space	Yes			
Yes	Clear Space To Crosswalk (in)	48			
N/A	Marked Crosswalk 1	Yes	N/A	Marked Crosswalk 2	Yes
	Crossing 1 Direction	N		Crossing 2 Direction	W
	Marked Crosswalk 1 Width (in)	144		Marked Crosswalk 2 Width (in)	144
Yes	Ramp Inside Crosswalk 1	Yes	Yes	Ramp Inside Crosswalk 2	Yes
	Crossing 1 Slope (%)	0.8		Crossing 2 Slope (%)	2.8
	Crossing 1 Cross Slope (%)	1.7		Crossing 2 Cross Slope (%)	0.2
Yes	Gutter Ponding	No	Yes	Curb Slope	0.5
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	2.2
No	Gutter Run Slope (%)	12.6		Road Cross Slope (%)	0.5
Yes	Gutter Cross Slope (%)	1.6	Yes	Perpendicular Joint Present	Yes
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A

