



Access Compliance Report

Public Rights-of-Way

(Curb Ramps)




Main Street: ISLAND_WAY Cross Street: ISLAND_WAY Location: E

ADA ID: RPRK220221171844 Ramp Type: Type 4 - Parallel Initial Pass/Fail: Pass Overall Compliance: Yes Severity Score: 0

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

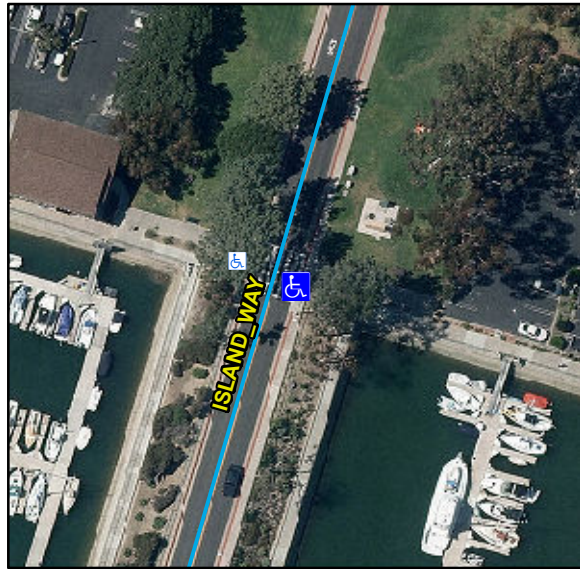

Possible Solutions:

N/A

Surveyor Notes:

N/A

OC Std/PROW:

N/A

Total Cost:

\$ 0

Parcel ID Number 682-022-16
Ramp Island Or Median None
Ramp Orientation NonDiag
Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.46152102,-117.69886947

Street 1 Name ISLAND_WAY
Stop Condition-Street 1 NoControl
Street 2 Name ISLAND_WAY
Stop Condition-Street 2 N/A

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	101	N/A	Ramp Length RT (in)	109
Yes	Ramp Width LT (in)	54	Yes	Ramp Width RT (in)	54
Yes	Ramp Run Slope LT (%)	3.4	Yes	Ramp Run Slope RT (%)	3.9
Yes	Ramp Cross Slope LT (%)	1.4	Yes	Ramp Cross Slope RT (%)	0.2
N/A	Landing Present	Yes	Yes	DWS Provided	Yes
N/A	Landing Length (in)	54	Yes	DWS Contrast	Yes
Yes	Landing Width (in)	48	Yes	DWS Length (in)	36
Yes	Landing Run Slope (%)	1.3	Yes	DWS Full Width	Yes
Yes	Landing Cross Slope (%)	1		DWS Offset Type	Single
N/A	Landing Movement Obstructed?	No	Yes	DWS Offset Left (in)	0
	Landing Movement Type	Curb	Yes	DWS Offset Right (in)	N/A
N/A	Landing Shared	No			
N/A	Clear Space	N/A			
N/A	Clear Space To Crosswalk (in)	N/A			
N/A	Marked Crosswalk 1	Yes	N/A	Marked Crosswalk 2	N/A
	Crossing 1 Direction	NW		Crossing 2 Direction	N/A
Yes	Marked Crosswalk 1 Width (in)	144		Marked Crosswalk 2 Width (in)	N/A
Yes	Ramp Inside Crosswalk 1	Yes	N/A	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	1.1		Crossing 2 Slope (%)	N/A
	Crossing 1 Cross Slope (%)	1		Crossing 2 Cross Slope (%)	N/A
Yes	Gutter Ponding	No	Yes	Curb Slope	4.3
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	N/A
Yes	Gutter Run Slope (%)	2.7		Road Cross Slope (%)	N/A
Yes	Gutter Cross Slope (%)	0.8	Yes	Perpendicular Joint Present	Yes
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A

