



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: N/A Cross Street: O_NEILL_DR Location: SE

ADA ID: RPRK220223170341 Ramp Type: Type 6 - Directional 1 Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 10

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

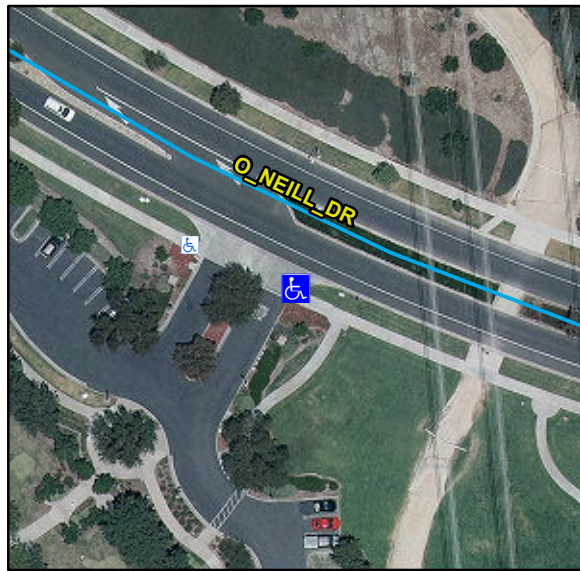

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

OC Std/PROW:

R304.5.2, R305, STD 1115

Total Cost:

\$ 3080

Parcel ID Number 741-311-48

Ramp Island Or Median None

Ramp Orientation NonDiag

Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.54530972,-117.64206731

Street 1 Name

N/A

Stop Condition-Street 1

NoControl

Street 2 Name

O_NEILL_DR

Stop Condition-Street 2

N/A

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	122	Yes	Flare Type LT	
Yes	Ramp Width (in)	72			Curbed2
Yes	Ramp Run Slope (%)	1.1	N/A	Flare Slope LT (%)	N/A
Yes	Ramp Cross Slope (%)	3.1	N/A	Flare Traversable LT	N/A
No	Grade Break	No	Yes	Flare Type RT	
N/A	Grade Break Slope (%)	N/A			Curbed2
N/A	Grade Break Cross Slope (%)	N/A	N/A	Flare Slope RT (%)	N/A
	Addl Para Ramp Left?	No	N/A	Flare Traversable RT	N/A
	Addl Para Ramp Right?	No	No	DWS Provided	No
N/A	Landing Present	Yes	N/A	DWS Contrast	N/A
Yes	Landing Length (in)	120	N/A	DWS Length (in)	N/A
Yes	Landing Width (in)	72	N/A	DWS Full Width	N/A
Yes	Landing Run Slope (%)	1.1		DWS Offset Type	N/A
Yes	Landing Cross Slope (%)	0.2	N/A	DWS Left Offset (in)	N/A
N/A	Landing Movement Obstructed?	No	N/A	DWS Right Offset (in)	N/A
	Landing Movement Type	N/A			
N/A	Landing Shared	No			
N/A	Marked Crosswalk 1	No	N/A	Clear Space	N/A
	Crossing 1 Direction	W	N/A	Clear Space To Crosswalk (in)	N/A
	Marked Crosswalk 1 Width (in)	N/A			
N/A	Ramp Inside Crosswalk 1	N/A			
	Crossing 1 Slope (%)	0.4			
	Crossing 1 Cross Slope (%)	3.6			
Yes	Gutter Ponding	No	Yes	Curb Slope	3
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	N/A
Yes	Gutter Run Slope (%)	0.2		Road Cross Slope (%)	N/A
Yes	Gutter Cross Slope (%)	2.4		Parallel Ramp Side	N/A
Yes	Overall Surface Condition	Acceptable	Yes	Perp Joint Present	Yes
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No

