



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: ORANGE_AVE Cross Street: S_GREENWICH_ST Location: SW

ADA ID: RPRK220224161507 Ramp Type: Type 4 - Parallel Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 2

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

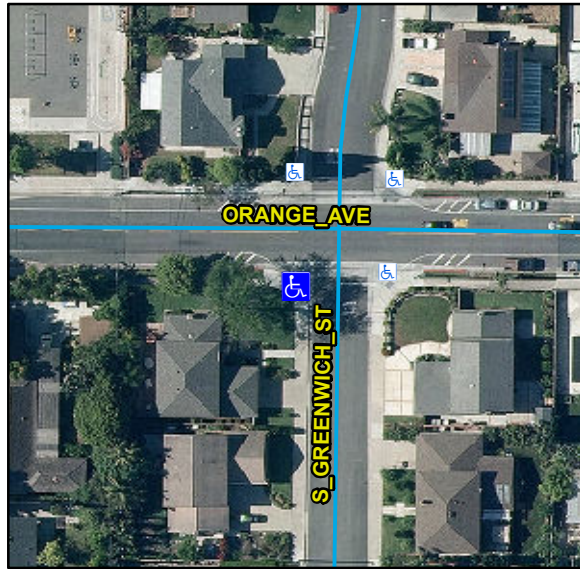

Possible Solutions:

Remove & Replace Landing.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.2-Perp, R304.3.2-Para, STD 1115

Total Cost: \$ 531

Parcel ID Number 127-231-39
Ramp Island Or Median None
Ramp Orientation Diag
Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.82492556,-117.96296957

Street 1 Name ORANGE_AVE
Stop Condition-Street 1 StopSign
Street 2 Name S_GREENWICH_ST
Stop Condition-Street 2 NoControl

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	80	N/A	Ramp Length RT (in)	84
Yes	Ramp Width LT (in)	84	Yes	Ramp Width RT (in)	84
Yes	Ramp Run Slope LT (%)	7.4	Yes	Ramp Run Slope RT (%)	6.9
Yes	Ramp Cross Slope LT (%)	1.5	Yes	Ramp Cross Slope RT (%)	2
N/A	Landing Present	Yes	Yes	DWS Provided	Yes
N/A	Landing Length (in)	84	Yes	DWS Contrast	Yes
Yes	Landing Width (in)	48	Yes	DWS Length (in)	36
No	Landing Run Slope (%)	2.3	Yes	DWS Full Width	Yes
Yes	Landing Cross Slope (%)	0.2		DWS Offset Type	Single
N/A	Landing Movement Obstructed?	Yes	Yes	DWS Offset Left (in)	0
	Landing Movement Type	Curb	Yes	DWS Offset Right (in)	N/A
N/A	Landing Shared	No			
N/A	Clear Space	Yes			
N/A	Clear Space To Crosswalk (in)	48			
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	E		Crossing 2 Direction	N
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	N/A	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	0.9		Crossing 2 Slope (%)	0.7
	Crossing 1 Cross Slope (%)	3.4		Crossing 2 Cross Slope (%)	4
Yes	Gutter Ponding	No	Yes	Curb Slope	0.1
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	1.2
Yes	Gutter Run Slope (%)	0.8		Road Cross Slope (%)	1.6
Yes	Gutter Cross Slope (%)	0.5	Yes	Perpendicular Joint Present	Yes
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No

