

Access Compliance Report Public Rights-of-Way (Pedestrian Signals)




Main Street: FOOTHILL_BLVD Cross Street: NEWPORT_AVE Location: NE

ADA ID: SGAT211018092322 Signal Type:One Push Button-Non APS Overall Compliance: No Severity Scores: BTN 1: 35 BTN 2: N/A No BTN: N/A

Codes/Miti	gation Info/P	Possible	Solution
------------	---------------	----------	----------

Field Measurements/Component Compliance

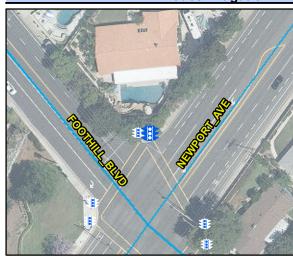

Possible Solutions: Replace Signal Push Button With APS Button. Provide Clear Space.

Surveyor Notes: N/A

OC Std/PROW: R404.1, MUTCD 4e.08

Total Cost:

1278





Compliance Description	Data	Compliance	Description	D	ata
Button Count	Button1	Yes Distant t	o Additional Bu	ıtton (in)	147
Additional Button Present?	Yes	N/A Addition	al Button ID	SGAT21101809	2640
Located In An Island/Median?	No				
N/A B 1 Sign Present?	Yes	N/A B 2 Sigr	Present?		N/A
Yes B 1 Sign Purpose?	Yes	N/A B 2 Sigr	Purpose?		N/A
Yes B 1 Sign Lettering & Contrast?	Yes	N/A B 2 Sigr	Lettering & Co	ontrast?	N/A
Yes B 1 Parallel To XWalk?	Yes	N/A B 2 Para	allel To XWalk?		N/A
N/A B 1 PAR to Button?	N/A	N/A B 2 PAR	to Button?		N/A
N/A B 1 PAR to XWalk?	N/A	N/A B 2 PAR	to XWalk?		N/A
No B 1 Clear Floor Space?	No	N/A B 2 Clea	ar Floor Space?	>	N/A
N/A B 1 FWD Approach?	N/A	N/A B 2 FW	Approach?		N/A
N/A B 1 FWD Approach Constrained?	N/A	N/A B 2 FW	Approach Co	nstrained?	N/A
N/A B 1 FWD Approach Reach (in)	N/A	N/A B2FWI	O Approach Re	ach (in)	N/A
N/A B 1 FWD Approach Width (in)	N/A	N/A B2FWI	O Approach Wi	dth (in)	N/A
N/A B 1 FWD Approach Obstruction?	N/A	N/A B2FWI	O Approach Ob	struction?	N/A
N/A B 1 FWD Approach Obstruction Dist	(in) N/A	N/A B2FW	O Approach Ob	structionDist (in)	N/A
N/A B 1 PARA Approach?	N/A	N/A B 2 PAR	A Approach?		N/A
N/A B 1 PARA Approach Constrained?	No	N/A B 2 PAR	A Approach Co	onstrained?	N/A
Yes B 1 PARA Approach Reach (in)	0	N/A B 2 PAR	A Approach Re	each (in)	N/A
N/A B 1 PARA Approach Width (in)	N/A	N/A B2PAR	A Approach W	idth (in)	N/A
N/A B 1 PARA Approach Obstruction?	No	N/A B 2 PAR	A Approach Ol	ostruction?	N/A
N/A B 1 PARA Approach Obstruction Dis	t (in) N/A	N/A B 2 PAR	A Approach Ol	ostruction Dist (in)	N/A
N/A B 1 Clear Floor Space Slope (%)	N/A	N/A B 2 Clea	ar Floor Space	Slope (%)	N/A
N/A B 1 Clear Floor Space XSlope (%)	N/A	N/A B 2 Clea	ar Floor Space	XSlope (%)	N/A
N/A B 1 PAR Slope (%)	N/A	N/A B 2 PAR	Slope (%)		N/A
Vas B 1 Height (in)	40	N/A R 2 Heid	tht (in)		N/Δ

APS	Compi	iance

N/A Is Button 1 APS or Non-APS?	NonAPS	N/A Is Button 2 APS or Non-APS?	N/A	N/A B 1 Clear Floor Space Slope (%)	N/A	N/A B 2 Clear Floor Space Slope (%)	N/A
N/A B 1 VibroTact Arrow?	N/A	N/A B 2 VibroTact Arrow?	N/A	N/A B 1 Clear Floor Space XSlope (%) N/A	N/A B 2 Clear Floor Space XSlope (%)	N/A
N/A B 1 VibroTact Parallel to Xing?	N/A	N/A B 2 VibroTact Parallel to Xing?	N/A	N/A B 1 PAR Slope (%)	N/A	N/A B 2 PAR Slope (%)	N/A
N/A B 1 VibroTact Contrast	N/A	N/A B 2 VibroTact Contrast	N/A	Yes B 1 Height (in)	40	N/A B 2 Height (in)	N/A
No B 1 Pilot Light?	No	N/A B 2 Pilot Light?	N/A	Yes B 1 Pressure (#)	5	N/A B 2 Pressure (#)	N/A
N/A B 1 Pilot Light Illumination?	N/A	N/A B 2 Pilot Light Illumination?	N/A	Yes B 1 Closed Fist Operation?	Yes	N/A B 2 Closed Fist Operation?	N/A
N/A B 1 Walk Indicator Type	N/A	N/A B 2 Walk Indicator Type	N/A	Yes B 1 Diameter (in)	2.25	N/A B 2 Diameter (in)	N/A
N/A B 1 Walk Indicator Audible?	N/A	N/A B 2 Walk Indicator Audible?	N/A	N/A B 1 Crossing Direction	s	N/A B 2 Crossing Direction	N/A
N/A B 1 Locator Tone?	N/A	N/A B 2 Locator Tone?	N/A	Yes B 1 DistanceTo XWalk (in)	23	N/A B 2 DistanceTo XWalk (in)	N/A
N/A B 1 Tone Audible Range?	N/A	N/A B 2 Tone Audible Range?	N/A	Yes B 1 DistanceTo Curb (in)	24	N/A B 2 DistanceTo Curb (in)	N/A
B 1 Addl APS Features?	No	B 2 Addl APS Features?	N/A	Parcel Identification Number	393-212-14		
B 1 Addl APS Features Notes	N/A	B 2 Addl APS Features Notes	N/A	Google Street View Link http://www.google.com/maps/@?api=1&m	ap_action=pano&	viewpoint=33.76705937,-117.79519777	