



Access Compliance Report Public Rights-of-Way (Pedestrian Signals)



Main Street: IRVINE_BLV D Cross Street: RED_HILL_AVE Location: SW

ADA ID: SGAT211027090737 Signal Type: One Push Button-APS Overall Compliance: No Severity Scores: BTN 1: 25 BTN 2: N/A No BTN: N/A

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance




Possible Solutions: Remove and Replace Clear Space.

Surveyor Notes: N/A

OC Std/PROW: R404.2, R404.3

Total Cost: \$ 378

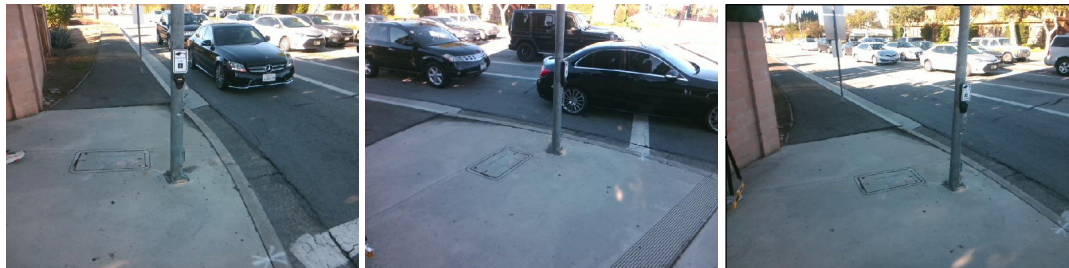

APS Compliance

N/A Is Button 1 APS or Non-APS?	APS	N/A Is Button 2 APS or Non-APS?	N/A
N/A B 1 VibroTact Arrow?	Yes	N/A B 2 VibroTact Arrow?	N/A
Yes B 1 VibroTact Parallel to Xing?	Yes	N/A B 2 VibroTact Parallel to Xing?	N/A
N/A B 1 VibroTact Contrast	Yes	N/A B 2 VibroTact Contrast	N/A
Yes B 1 Pilot Light?	Yes	N/A B 2 Pilot Light?	N/A
Yes B 1 Pilot Light Illumination?	Yes	N/A B 2 Pilot Light Illumination?	N/A
N/A B 1 Walk Indicator Type	VerbalMessage	N/A B 2 Walk Indicator Type	N/A
N/A B 1 Walk Indicator Audible?	Yes	N/A B 2 Walk Indicator Audible?	N/A
N/A B 1 Locator Tone?	Yes	N/A B 2 Locator Tone?	N/A
N/A B 1 Tone Audible Range?	Yes	N/A B 2 Tone Audible Range?	N/A
B 1 Addl APS Features?	No	B 2 Addl APS Features?	N/A
B 1 Addl APS Features Notes	N/A	B 2 Addl APS Features Notes	N/A

Compliance	Description	Data	Compliance	Description	Data
Button Count	Button1	Yes	Yes	Distant to Additional Button (in)	308
Additional Button Present?	Yes	N/A	N/A	Additional Button ID	SGAT211027090558
Located In An Island/Median?	No				
N/A B 1 Sign Present?	Yes	N/A	N/A	B 2 Sign Present?	N/A
Yes B 1 Sign Purpose?	Yes	N/A	N/A	B 2 Sign Purpose?	N/A
Yes B 1 Sign Lettering & Contrast?	Yes	N/A	N/A	B 2 Sign Lettering & Contrast?	N/A
Yes B 1 Parallel To XWalk?	Yes	N/A	N/A	B 2 Parallel To XWalk?	N/A
N/A B 1 PAR to Button?	N/A	N/A	N/A	B 2 PAR to Button?	N/A
N/A B 1 PAR to XWalk?	N/A	N/A	N/A	B 2 PAR to XWalk?	N/A
Yes B 1 Clear Floor Space?	Yes	N/A	N/A	B 2 Clear Floor Space?	N/A
N/A B 1 FWD Approach?	N/A	N/A	N/A	B 2 FWD Approach?	N/A
N/A B 1 FWD Approach Constrained?	N/A	N/A	N/A	B 2 FWD Approach Constrained?	N/A
N/A B 1 FWD Approach Reach (in)	N/A	N/A	N/A	B 2 FWD Approach Reach (in)	N/A
N/A B 1 FWD Approach Width (in)	N/A	N/A	N/A	B 2 FWD Approach Width (in)	N/A
N/A B 1 FWD Approach Obstruction?	N/A	N/A	N/A	B 2 FWD Approach Obstruction?	N/A
N/A B 1 FWD Approach Obstruction Dist (in)	N/A	N/A	N/A	B 2 FWD Approach ObstructionDist (in)	N/A
N/A B 1 PARA Approach?	N/A	N/A	N/A	B 2 PARA Approach?	N/A
N/A B 1 PARA Approach Constrained?	No	N/A	N/A	B 2 PARA Approach Constrained?	N/A
Yes B 1 PARA Approach Reach (in)	0	N/A	N/A	B 2 PARA Approach Reach (in)	N/A
N/A B 1 PARA Approach Width (in)	N/A	N/A	N/A	B 2 PARA Approach Width (in)	N/A
N/A B 1 PARA Approach Obstruction?	No	N/A	N/A	B 2 PARA Approach Obstruction?	N/A
N/A B 1 PARA Approach Obstruction Dist (in)	N/A	N/A	N/A	B 2 PARA Approach Obstruction Dist (in)	N/A
No B 1 Clear Floor Space Slope (%)	5.7	N/A	N/A	B 2 Clear Floor Space Slope (%)	N/A
No B 1 Clear Floor Space XSlope (%)	3.6	N/A	N/A	B 2 Clear Floor Space XSlope (%)	N/A
N/A B 1 PAR Slope (%)	2.5	N/A	N/A	B 2 PAR Slope (%)	N/A
Yes B 1 Height (in)	43	N/A	N/A	B 2 Height (in)	N/A
Yes B 1 Pressure (#)	5	N/A	N/A	B 2 Pressure (#)	N/A
Yes B 1 Closed Fist Operation?	Yes	N/A	N/A	B 2 Closed Fist Operation?	N/A
Yes B 1 Diameter (in)	2.25	N/A	N/A	B 2 Diameter (in)	N/A
N/A B 1 Crossing Direction	N	N/A	N/A	B 2 Crossing Direction	N/A
Yes B 1 DistanceTo XWalk (in)	40	N/A	N/A	B 2 DistanceTo XWalk (in)	N/A
Yes B 1 DistanceTo Curb (in)	29	N/A	N/A	B 2 DistanceTo Curb (in)	N/A
Parcel Identification Number	103-471-50				
Google Street View Link					
	http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.74448042,-117.80431661				