



Access Compliance Report Public Rights-of-Way (Pedestrian Signals)




Main Street: NONE Cross Street: PROSPECT_ST Location: N

ADA ID: SGAT211028084226 Signal Type: One Push Button-Non APS Overall Compliance: No Severity Scores: BTN 1: 10 BTN 2: N/A No BTN: N/A

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

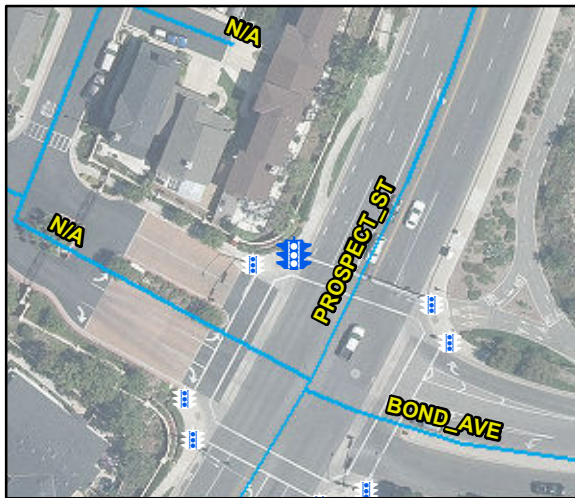

Possible Solutions: Replace Signal Push Button With APS Button.

Surveyor Notes: N/A

OC Std/PROW: MUTCD 4e.08

Total Cost: \$ 900



Compliance	Description	Data	Compliance	Description	Data
Button Count		Button1	Yes	Distant to Additional Button (in)	264
Additional Button Present?		Yes	N/A	Additional Button ID	SGAT211028084112
Located In An Island/Median?		No			
N/A	B 1 Sign Present?	Yes	N/A	B 2 Sign Present?	N/A
Yes	B 1 Sign Purpose?	Yes	N/A	B 2 Sign Purpose?	N/A
Yes	B 1 Sign Lettering & Contrast?	Yes	N/A	B 2 Sign Lettering & Contrast?	N/A
Yes	B 1 Parallel To XWalk?	Yes	N/A	B 2 Parallel To XWalk?	N/A
N/A	B 1 PAR to Button?	N/A	N/A	B 2 PAR to Button?	N/A
N/A	B 1 PAR to XWalk?	N/A	N/A	B 2 PAR to XWalk?	N/A
Yes	B 1 Clear Floor Space?	Yes	N/A	B 2 Clear Floor Space?	N/A
N/A	B 1 FWD Approach?	N/A	N/A	B 2 FWD Approach?	N/A
N/A	B 1 FWD Approach Constrained?	N/A	N/A	B 2 FWD Approach Constrained?	N/A
N/A	B 1 FWD Approach Reach (in)	N/A	N/A	B 2 FWD Approach Reach (in)	N/A
N/A	B 1 FWD Approach Width (in)	N/A	N/A	B 2 FWD Approach Width (in)	N/A
N/A	B 1 FWD Approach Obstruction?	N/A	N/A	B 2 FWD Approach Obstruction?	N/A
N/A	B 1 FWD Approach Obstruction Dist (in)	N/A	N/A	B 2 FWD Approach ObstructionDist (in)	N/A
N/A	B 1 PARA Approach?	N/A	N/A	B 2 PARA Approach?	N/A
N/A	B 1 PARA Approach Constrained?	No	N/A	B 2 PARA Approach Constrained?	N/A
Yes	B 1 PARA Approach Reach (in)	0	N/A	B 2 PARA Approach Reach (in)	N/A
N/A	B 1 PARA Approach Width (in)	N/A	N/A	B 2 PARA Approach Width (in)	N/A
N/A	B 1 PARA Approach Obstruction?	No	N/A	B 2 PARA Approach Obstruction?	N/A
N/A	B 1 PARA Approach Obstruction Dist (in)	N/A	N/A	B 2 PARA Approach Obstruction Dist (in)	N/A
Yes	B 1 Clear Floor Space Slope (%)	2.3	N/A	B 2 Clear Floor Space Slope (%)	N/A
Yes	B 1 Clear Floor Space XSlope (%)	0.3	N/A	B 2 Clear Floor Space XSlope (%)	N/A
N/A	B 1 PAR Slope (%)	2.3	N/A	B 2 PAR Slope (%)	N/A
Yes	B 1 Height (in)	47	N/A	B 2 Height (in)	N/A
Yes	B 1 Pressure (#)	5	N/A	B 2 Pressure (#)	N/A
Yes	B 1 Closed Fist Operation?	Yes	N/A	B 2 Closed Fist Operation?	N/A
Yes	B 1 Diameter (in)	2.25	N/A	B 2 Diameter (in)	N/A
N/A	B 1 Crossing Direction	SE	N/A	B 2 Crossing Direction	N/A
Yes	B 1 DistanceTo XWalk (in)	14	N/A	B 2 DistanceTo XWalk (in)	N/A
Yes	B 1 DistanceTo Curb (in)	32	N/A	B 2 DistanceTo Curb (in)	N/A

Parcel Identification Number 383-321-42

Google Street View Link

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.79901567,-117.81496546

APS Compliance

N/A	Is Button 1 APS or Non-APS?	NonAPS	N/A	Is Button 2 APS or Non-APS?	N/A
N/A	B 1 VibroTact Arrow?	N/A	N/A	B 2 VibroTact Arrow?	N/A
N/A	B 1 VibroTact Parallel to Xing?	N/A	N/A	B 2 VibroTact Parallel to Xing?	N/A
N/A	B 1 VibroTact Contrast	N/A	N/A	B 2 VibroTact Contrast	N/A
No	B 1 Pilot Light?	No	N/A	B 2 Pilot Light?	N/A
N/A	B 1 Pilot Light Illumination?	N/A	N/A	B 2 Pilot Light Illumination?	N/A
N/A	B 1 Walk Indicator Type	N/A	N/A	B 2 Walk Indicator Type	N/A
N/A	B 1 Walk Indicator Audible?	N/A	N/A	B 2 Walk Indicator Audible?	N/A
N/A	B 1 Locator Tone?	N/A	N/A	B 2 Locator Tone?	N/A
N/A	B 1 Tone Audible Range?	N/A	N/A	B 2 Tone Audible Range?	N/A
	B 1 Addl APS Features?	No		B 2 Addl APS Features?	N/A
	B 1 Addl APS Features Notes	N/A		B 2 Addl APS Features Notes	N/A