



Access Compliance Report Public Rights-of-Way (Pedestrian Signals)




Main Street: **SANTA ANA_AVE** Cross Street: **MESA_DR** Location: **SW**

ADA ID: **SGAT220128171317** Signal Type: **Two Push Buttons-Non APS** Overall Compliance: **No** Severity Scores: **BTN 1: 35** **BTN 2: 35** **No BTN: N/A**

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

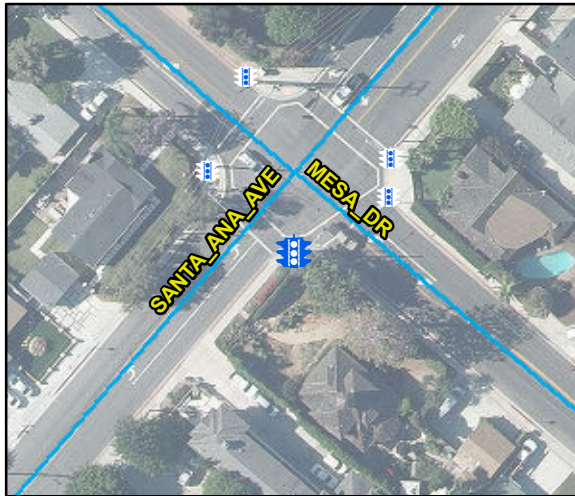

Possible Solutions: Replace Signal Push Button With APS Button. Remove and Replace Clear Space.

Surveyor Notes: **N/A**

OC Std/PROW: **R404.2, R403.4, MUTCD 4e.08, DMS-11132, R104.2, R209.1**

Total Cost: \$ **2556**



APS Compliance

N/A	Is Button 1 APS or Non-APS?	NonAPS	N/A	Is Button 2 APS or Non-APS?	NonAPS
N/A	B 1 VibroTact Arrow?	N/A	N/A	B 2 VibroTact Arrow?	N/A
N/A	B 1 VibroTact Parallel to Xing?	N/A	N/A	B 2 VibroTact Parallel to Xing?	N/A
N/A	B 1 VibroTact Contrast	N/A	N/A	B 2 VibroTact Contrast	N/A
No	B 1 Pilot Light?	No	No	B 2 Pilot Light?	No
N/A	B 1 Pilot Light Illumination?	N/A	N/A	B 2 Pilot Light Illumination?	N/A
N/A	B 1 Walk Indicator Type	N/A	N/A	B 2 Walk Indicator Type	N/A
N/A	B 1 Walk Indicator Audible?	N/A	N/A	B 2 Walk Indicator Audible?	N/A
N/A	B 1 Locator Tone?	N/A	N/A	B 2 Locator Tone?	N/A
N/A	B 1 Tone Audible Range?	N/A	N/A	B 2 Tone Audible Range?	N/A
	B 1 Addl APS Features?	No		B 2 Addl APS Features?	No
	B 1 Addl APS Features Notes	N/A		B 2 Addl APS Features Notes	N/A

Compliance	Description	Data	Compliance	Description	Data
	Button Count	Button2	N/A	Distant to Additional Button (in)	N/A
	Additional Button Present?	No	N/A	Additional Button ID	N/A
	Located In An Island/Median?	No			
N/A	B 1 Sign Present?	Yes	N/A	B 2 Sign Present?	Yes
Yes	B 1 Sign Purpose?	Yes	Yes	B 2 Sign Purpose?	Yes
Yes	B 1 Sign Lettering & Contrast?	Yes	Yes	B 2 Sign Lettering & Contrast?	Yes
Yes	B 1 Parallel To XWalk?	Yes	Yes	B 2 Parallel To XWalk?	Yes
N/A	B 1 PAR to Button?	N/A	N/A	B 2 PAR to Button?	N/A
N/A	B 1 PAR to XWalk?	N/A	N/A	B 2 PAR to XWalk?	N/A
Yes	B 1 Clear Floor Space?	Yes	Yes	B 2 Clear Floor Space?	Yes
N/A	B 1 FWD Approach?	N/A	N/A	B 2 FWD Approach?	N/A
N/A	B 1 FWD Approach Constrained?	N/A	N/A	B 2 FWD Approach Constrained?	N/A
N/A	B 1 FWD Approach Reach (in)	N/A	N/A	B 2 FWD Approach Reach (in)	N/A
N/A	B 1 FWD Approach Width (in)	N/A	N/A	B 2 FWD Approach Width (in)	N/A
N/A	B 1 FWD Approach Obstruction?	N/A	N/A	B 2 FWD Approach Obstruction?	N/A
N/A	B 1 FWD Approach Obstruction Dist (in)	N/A	N/A	B 2 FWD Approach ObstructionDist (in)	N/A
N/A	B 1 PARA Approach?	N/A	N/A	B 2 PARA Approach?	N/A
N/A	B 1 PARA Approach Constrained?	No	N/A	B 2 PARA Approach Constrained?	No
Yes	B 1 PARA Approach Reach (in)	4	Yes	B 2 PARA Approach Reach (in)	4
N/A	B 1 PARA Approach Width (in)	N/A	N/A	B 2 PARA Approach Width (in)	N/A
N/A	B 1 PARA Approach Obstruction?	No	N/A	B 2 PARA Approach Obstruction?	No
N/A	B 1 PARA Approach Obstruction Dist (in)	N/A	N/A	B 2 PARA Approach Obstruction Dist (in)	N/A
Yes	B 1 Clear Floor Space Slope (%)	1.4	Yes	B 2 Clear Floor Space Slope (%)	5.5
No	B 1 Clear Floor Space XSlope (%)	9.4	No	B 2 Clear Floor Space XSlope (%)	3.5
N/A	B 1 PAR Slope (%)	2.1	N/A	B 2 PAR Slope (%)	7.6
Yes	B 1 Height (in)	48	Yes	B 2 Height (in)	48
No	B 1 Pressure (#)	7	No	B 2 Pressure (#)	9
Yes	B 1 Closed Fist Operation?	Yes	No	B 2 Closed Fist Operation?	No
Yes	B 1 Diameter (in)	2	Yes	B 2 Diameter (in)	0.25
N/A	B 1 Crossing Direction	E	N/A	B 2 Crossing Direction	NW
Yes	B 1 DistanceTo XWalk (in)	0	Yes	B 2 DistanceTo XWalk (in)	54
Yes	B 1 DistanceTo Curb (in)	24	Yes	B 2 DistanceTo Curb (in)	24

Parcel Identification Number **439-101-10**

Google Street View Link

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.66087141,-117.88759188