



Access Compliance Report

Public Rights-of-Way

(Pedestrian Signals)



Main Street: BALL_RD Cross Street: S_BROOKHURST_ST Location: SW

ADA ID: SGAT220202154208 Signal Type: One Push Button-Non APS Overall Compliance: No Severity Scores: BTN 1: 10 BTN 2: N/A No BTN: N/A

Codes/Mitigation Info/Possible Solution Field Measurements/Component Compliance




Possible Solutions: Replace Signal Push Button With APS Button.

Surveyor Notes: N/A

OC Std/PROW: R403.4, DMS-11132, R104.2, R209.1, MUTCD 4e.08

Total Cost: \$ 900

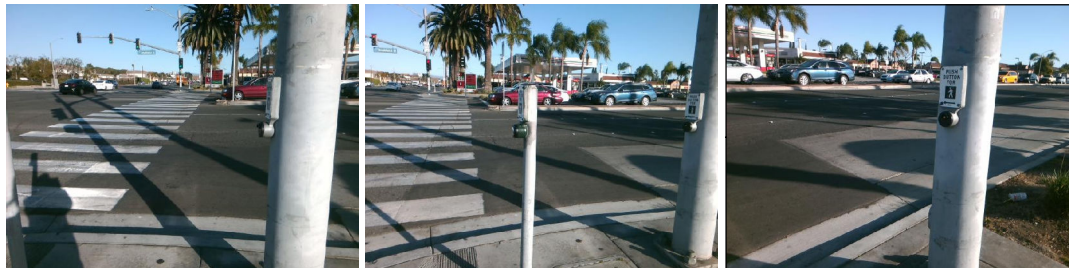

APS Compliance

N/A Is Button 1 APS or Non-APS?	NonAPS	N/A Is Button 2 APS or Non-APS?	N/A
N/A B 1 VibroTact Arrow?	N/A	N/A B 2 VibroTact Arrow?	N/A
N/A B 1 VibroTact Parallel to Xing?	N/A	N/A B 2 VibroTact Parallel to Xing?	N/A
N/A B 1 VibroTact Contrast	N/A	N/A B 2 VibroTact Contrast	N/A
No B 1 Pilot Light?	No	N/A B 2 Pilot Light?	N/A
N/A B 1 Pilot Light Illumination?	N/A	N/A B 2 Pilot Light Illumination?	N/A
N/A B 1 Walk Indicator Type	N/A	N/A B 2 Walk Indicator Type	N/A
N/A B 1 Walk Indicator Audible?	N/A	N/A B 2 Walk Indicator Audible?	N/A
N/A B 1 Locator Tone?	N/A	N/A B 2 Locator Tone?	N/A
N/A B 1 Tone Audible Range?	N/A	N/A B 2 Tone Audible Range?	N/A
B 1 Addl APS Features?	No	B 2 Addl APS Features?	N/A
B 1 Addl APS Features Notes	N/A	B 2 Addl APS Features Notes	N/A

Compliance	Description	Data	Compliance	Description	Data
Button Count	Button1	Yes	Distant to Additional Button (in)	306	
Additional Button Present?	Yes	N/A	Additional Button ID	SGAT220202153756	
Located In An Island/Median?	No				
N/A B 1 Sign Present?	Yes	N/A	B 2 Sign Present?	N/A	
Yes B 1 Sign Purpose?	Yes	N/A	B 2 Sign Purpose?	N/A	
Yes B 1 Sign Lettering & Contrast?	Yes	N/A	B 2 Sign Lettering & Contrast?	N/A	
Yes B 1 Parallel To XWalk?	Yes	N/A	B 2 Parallel To XWalk?	N/A	
N/A B 1 PAR to Button?	N/A	N/A	B 2 PAR to Button?	N/A	
N/A B 1 PAR to XWalk?	N/A	N/A	B 2 PAR to XWalk?	N/A	
Yes B 1 Clear Floor Space?	Yes	N/A	B 2 Clear Floor Space?	N/A	
N/A B 1 FWD Approach?	N/A	N/A	B 2 FWD Approach?	N/A	
N/A B 1 FWD Approach Constrained?	N/A	N/A	B 2 FWD Approach Constrained?	N/A	
N/A B 1 FWD Approach Reach (in)	N/A	N/A	B 2 FWD Approach Reach (in)	N/A	
N/A B 1 FWD Approach Width (in)	N/A	N/A	B 2 FWD Approach Width (in)	N/A	
N/A B 1 FWD Approach Obstruction?	N/A	N/A	B 2 FWD Approach Obstruction?	N/A	
N/A B 1 FWD Approach Obstruction Dist (in)	N/A	N/A	B 2 FWD Approach ObstructionDist (in)	N/A	
N/A B 1 PARA Approach?	N/A	N/A	B 2 PARA Approach?	N/A	
N/A B 1 PARA Approach Constrained?	No	N/A	B 2 PARA Approach Constrained?	N/A	
Yes B 1 PARA Approach Reach (in)	3	N/A	B 2 PARA Approach Reach (in)	N/A	
N/A B 1 PARA Approach Width (in)	N/A	N/A	B 2 PARA Approach Width (in)	N/A	
N/A B 1 PARA Approach Obstruction?	No	N/A	B 2 PARA Approach Obstruction?	N/A	
N/A B 1 PARA Approach Obstruction Dist (in)	N/A	N/A	B 2 PARA Approach Obstruction Dist (in)	N/A	
Yes B 1 Clear Floor Space Slope (%)	0.6	N/A	B 2 Clear Floor Space Slope (%)	N/A	
Yes B 1 Clear Floor Space XSlope (%)	0.4	N/A	B 2 Clear Floor Space XSlope (%)	N/A	
N/A B 1 PAR Slope (%)	2.6	N/A	B 2 PAR Slope (%)	N/A	
Yes B 1 Height (in)	45	N/A	B 2 Height (in)	N/A	
No B 1 Pressure (#)	7	N/A	B 2 Pressure (#)	N/A	
No B 1 Closed Fist Operation?	No	N/A	B 2 Closed Fist Operation?	N/A	
No B 1 Diameter (in)	0.25	N/A	B 2 Diameter (in)	N/A	
N/A B 1 Crossing Direction	SE	N/A	B 2 Crossing Direction	N/A	
Yes B 1 DistanceTo XWalk (in)	60	N/A	B 2 DistanceTo XWalk (in)	N/A	
Yes B 1 DistanceTo Curb (in)	23	N/A	B 2 DistanceTo Curb (in)	N/A	
Parcel Identification Number	127-371-65				
Google Street View Link					
http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.81758842,-117.95910542					