



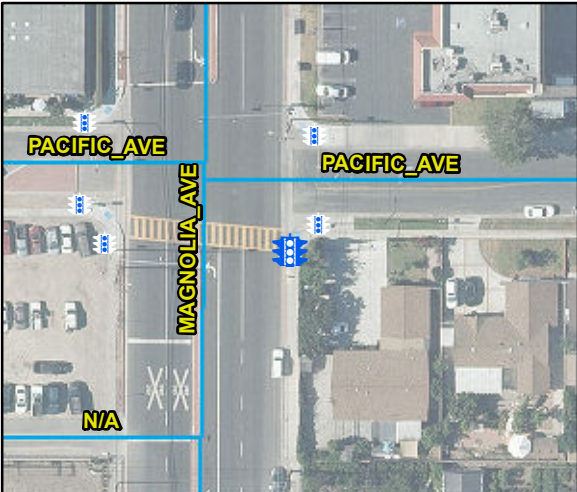
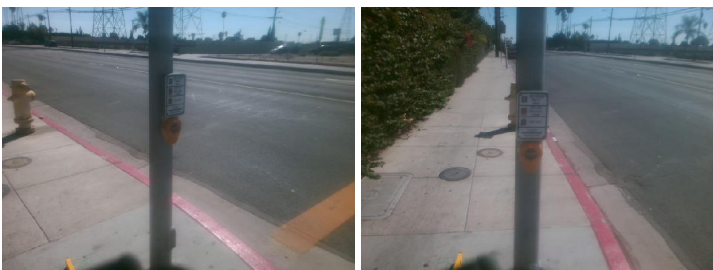

Access Compliance Report Public Rights-of-Way (Pedestrian Signals)

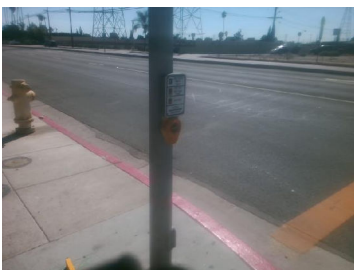
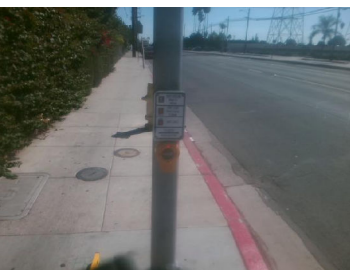


Main Street: MAGNOLIA_AVE	Cross Street: N/A	Location: S
----------------------------------	--------------------------	--------------------

ADA ID: SGRK210921175333	Signal Type: One Push Button-APS	Overall Compliance: Yes	Severity Scores: BTN 1: 0 BTN 2: N/A No BTN: N/A
---------------------------------	---	--------------------------------	---

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

	Possible Solutions: N/A	Compliance	Description	Data	Compliance	Description	Data
			Button Count	Button1	Yes	Distant to Additional Button (in)	200
			Additional Button Present?	Yes	N/A	Additional Button ID	SGRK210921175106
			Located In An Island/Median?	No			
			N/A B 1 Sign Present?	Yes	N/A	B 2 Sign Present?	N/A
			Yes B 1 Sign Purpose?	Yes	N/A	B 2 Sign Purpose?	N/A
			Yes B 1 Sign Lettering & Contrast?	Yes	N/A	B 2 Sign Lettering & Contrast?	N/A
			Yes B 1 Parallel To XWalk?	Yes	N/A	B 2 Parallel To XWalk?	N/A
			N/A B 1 PAR to Button?	N/A	N/A	B 2 PAR to Button?	N/A
			N/A B 1 PAR to XWalk?	N/A	N/A	B 2 PAR to XWalk?	N/A
	Surveyor Notes: N/A		Yes B 1 Clear Floor Space?	Yes	N/A	B 2 Clear Floor Space?	N/A
			N/A B 1 FWD Approach?	N/A	N/A	B 2 FWD Approach?	N/A
			N/A B 1 FWD Approach Constrained?	N/A	N/A	B 2 FWD Approach Constrained?	N/A
			N/A B 1 FWD Approach Reach (in)	N/A	N/A	B 2 FWD Approach Reach (in)	N/A
			N/A B 1 FWD Approach Width (in)	N/A	N/A	B 2 FWD Approach Width (in)	N/A
			N/A B 1 FWD Approach Obstruction?	N/A	N/A	B 2 FWD Approach Obstruction?	N/A
			N/A B 1 FWD Approach Obstruction Dist (in)	N/A	N/A	B 2 FWD Approach ObstructionDist (in)	N/A
			N/A B 1 PARA Approach?	N/A	N/A	B 2 PARA Approach?	N/A
			N/A B 1 PARA Approach Constrained?	No	N/A	B 2 PARA Approach Constrained?	N/A
			Yes B 1 PARA Approach Reach (in)	0	N/A	B 2 PARA Approach Reach (in)	N/A
	OC Std/PROW: N/A		N/A B 1 PARA Approach Width (in)	N/A	N/A	B 2 PARA Approach Width (in)	N/A
			N/A B 1 PARA Approach Obstruction?	No	N/A	B 2 PARA Approach Obstruction?	N/A
			N/A B 1 PARA Approach Obstruction Dist (in)	N/A	N/A	B 2 PARA Approach Obstruction Dist (in)	N/A
			Yes B 1 Clear Floor Space Slope (%)	1.7	N/A	B 2 Clear Floor Space Slope (%)	N/A
			Yes B 1 Clear Floor Space XSlope (%)	0.1	N/A	B 2 Clear Floor Space XSlope (%)	N/A
			N/A B 1 PAR Slope (%)	1.4	N/A	B 2 PAR Slope (%)	N/A
			Yes B 1 Height (in)	40	N/A	B 2 Height (in)	N/A
			Yes B 1 Pressure (#)	5	N/A	B 2 Pressure (#)	N/A
			Yes B 1 Closed Fist Operation?	Yes	N/A	B 2 Closed Fist Operation?	N/A
			Yes B 1 Diameter (in)	2	N/A	B 2 Diameter (in)	N/A
Total Cost: \$ 0			N/A B 1 Crossing Direction	W	N/A	B 2 Crossing Direction	N/A
			Yes B 1 DistanceTo XWalk (in)	0	N/A	B 2 DistanceTo XWalk (in)	N/A
			Yes B 1 DistanceTo Curb (in)	24	N/A	B 2 DistanceTo Curb (in)	N/A

							
---	--	--	--	--	--	--	--

APS Compliance				Parcel Identification Number			
N/A	Is Button 1 APS or Non-APS?	APS	N/A	Is Button 2 APS or Non-APS?	N/A	127-463-08	
N/A	B 1 VibroTact Arrow?	Yes	N/A	B 2 VibroTact Arrow?	N/A	Google Street View Link	
Yes	B 1 VibroTact Parallel to Xing?	Yes	N/A	B 2 VibroTact Parallel to Xing?	N/A	http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.80756391,-117.97555846	
N/A	B 1 VibroTact Contrast	Yes	N/A	B 2 VibroTact Contrast	N/A		
Yes	B 1 Pilot Light?	Yes	N/A	B 2 Pilot Light?	N/A		
Yes	B 1 Pilot Light Illumination?	Yes	N/A	B 2 Pilot Light Illumination?	N/A		
N/A	B 1 Walk Indicator Type	VerbalMessage	N/A	B 2 Walk Indicator Type	N/A		
N/A	B 1 Walk Indicator Audible?	Yes	N/A	B 2 Walk Indicator Audible?	N/A		
N/A	B 1 Locator Tone?	Yes	N/A	B 2 Locator Tone?	N/A		
N/A	B 1 Tone Audible Range?	Yes	N/A	B 2 Tone Audible Range?	N/A		
	B 1 Addl APS Features?	Yes		B 2 Addl APS Features?	N/A		
	B 1 Addl APS Features Notes	N/A		B 2 Addl APS Features Notes	N/A		