




Access Compliance Report Public Rights-of-Way (Pedestrian Signals)



Main Street: **ESENCIA_DR** Cross Street: **CHIQUITA_CANYON_DR** Location: **NE**

ADA ID: **SGRK211124134058** Signal Type: **One Push Button-Non APS** Overall Compliance: **No** Severity Scores: **BTN 1: 35** **BTN 2: N/A** **No BTN: N/A**

Codes/Mitigation Info/Possible Solution **Field Measurements/Component Compliance**


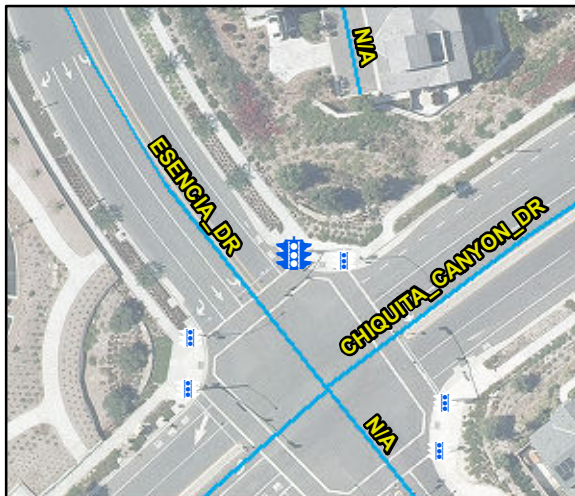


Possible Solutions: Replace Signal Push Button With APS Button. Remove and Replace Clear Space.

Surveyor Notes: **N/A**

OC Std/PROW: **R404.2, R404.3, MUTCD 4e.08**

Total Cost: \$ **1278**

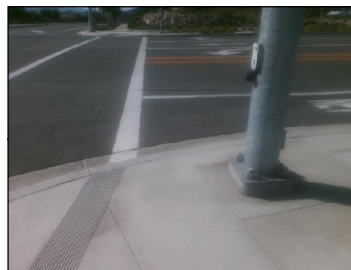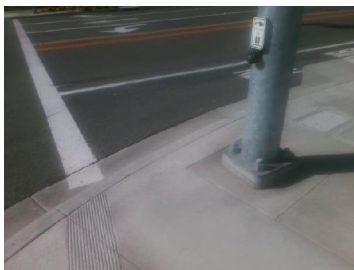

APS Compliance

N/A Is Button 1 APS or Non-APS?	NonAPS	N/A Is Button 2 APS or Non-APS?	N/A
N/A B 1 VibroTact Arrow?	N/A	N/A B 2 VibroTact Arrow?	N/A
N/A B 1 VibroTact Parallel to Xing?	N/A	N/A B 2 VibroTact Parallel to Xing?	N/A
N/A B 1 VibroTact Contrast	N/A	N/A B 2 VibroTact Contrast	N/A
No B 1 Pilot Light?	No	N/A B 2 Pilot Light?	N/A
N/A B 1 Pilot Light Illumination?	N/A	N/A B 2 Pilot Light Illumination?	N/A
N/A B 1 Walk Indicator Type	N/A	N/A B 2 Walk Indicator Type	N/A
N/A B 1 Walk Indicator Audible?	N/A	N/A B 2 Walk Indicator Audible?	N/A
N/A B 1 Locator Tone?	N/A	N/A B 2 Locator Tone?	N/A
N/A B 1 Tone Audible Range?	N/A	N/A B 2 Tone Audible Range?	N/A
B 1 Addl APS Features?	No	B 2 Addl APS Features?	N/A
B 1 Addl APS Features Notes	N/A	B 2 Addl APS Features Notes	N/A

Compliance	Description	Data	Compliance	Description	Data
	Button Count	Button1	Yes	Distant to Additional Button (in)	315
	Additional Button Present?	Yes	N/A	Additional Button ID	SGRK211124133943
	Located In An Island/Median?	No			
N/A	B 1 Sign Present?	Yes	N/A	B 2 Sign Present?	N/A
Yes	B 1 Sign Purpose?	Yes	N/A	B 2 Sign Purpose?	N/A
Yes	B 1 Sign Lettering & Contrast?	Yes	N/A	B 2 Sign Lettering & Contrast?	N/A
Yes	B 1 Parallel To XWalk?	Yes	N/A	B 2 Parallel To XWalk?	N/A
N/A	B 1 PAR to Button?	N/A	N/A	B 2 PAR to Button?	N/A
N/A	B 1 PAR to XWalk?	N/A	N/A	B 2 PAR to XWalk?	N/A
Yes	B 1 Clear Floor Space?	Yes	N/A	B 2 Clear Floor Space?	N/A
N/A	B 1 FWD Approach?	N/A	N/A	B 2 FWD Approach?	N/A
N/A	B 1 FWD Approach Constrained?	N/A	N/A	B 2 FWD Approach Constrained?	N/A
N/A	B 1 FWD Approach Reach (in)	N/A	N/A	B 2 FWD Approach Reach (in)	N/A
N/A	B 1 FWD Approach Width (in)	N/A	N/A	B 2 FWD Approach Width (in)	N/A
N/A	B 1 FWD Approach Obstruction?	N/A	N/A	B 2 FWD Approach Obstruction?	N/A
N/A	B 1 FWD Approach Obstruction Dist (in)	N/A	N/A	B 2 FWD Approach ObstructionDist (in)	N/A
N/A	B 1 PARA Approach?	N/A	N/A	B 2 PARA Approach?	N/A
N/A	B 1 PARA Approach Constrained?	No	N/A	B 2 PARA Approach Constrained?	N/A
Yes	B 1 PARA Approach Reach (in)	0	N/A	B 2 PARA Approach Reach (in)	N/A
N/A	B 1 PARA Approach Width (in)	N/A	N/A	B 2 PARA Approach Width (in)	N/A
N/A	B 1 PARA Approach Obstruction?	No	N/A	B 2 PARA Approach Obstruction?	N/A
N/A	B 1 PARA Approach Obstruction Dist (in)	N/A	N/A	B 2 PARA Approach Obstruction Dist (in)	N/A
No	B 1 Clear Floor Space Slope (%)	3.1	N/A	B 2 Clear Floor Space Slope (%)	N/A
Yes	B 1 Clear Floor Space XSlope (%)	0.7	N/A	B 2 Clear Floor Space XSlope (%)	N/A
N/A	B 1 PAR Slope (%)	2.8	N/A	B 2 PAR Slope (%)	N/A
Yes	B 1 Height (in)	40	N/A	B 2 Height (in)	N/A
Yes	B 1 Pressure (#)	5	N/A	B 2 Pressure (#)	N/A
Yes	B 1 Closed Fist Operation?	Yes	N/A	B 2 Closed Fist Operation?	N/A
Yes	B 1 Diameter (in)	2	N/A	B 2 Diameter (in)	N/A
N/A	B 1 Crossing Direction	SW	N/A	B 2 Crossing Direction	N/A
Yes	B 1 DistanceTo XWalk (in)	52	N/A	B 2 DistanceTo XWalk (in)	N/A
Yes	B 1 DistanceTo Curb (in)	35	N/A	B 2 DistanceTo Curb (in)	N/A
	Parcel Identification Number	125-271-13			
	Google Street View Link				
	http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.54555579,-117.60015926				