


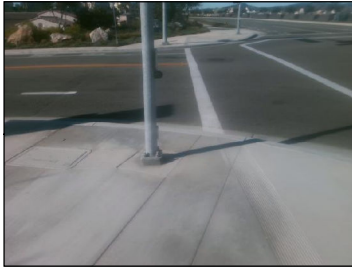

Main Street: CHIQUITA_CANYON_DR		Cross Street: AIROSO_ST		Location:		SE	
ADA ID: SGRK211130124642		Signal Type:One Push Button-Non APS		Overall Compliance: No		Severity Scores: BTN 1: 35 BTN 2: N/A No BTN: N/A	
Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance			
		Possible Solutions: Replace Signal Push Button With APS Button. Remove and Replace Clear Space. Surveyor Notes: N/A OC Std/PROW: R404.2, MUTCD 4e.08 Total Cost: \$ 1278					
							
APS Compliance							
N/A Is Button 1 APS or Non-APS?	NonAPS	N/A Is Button 2 APS or Non-APS?	N/A				
N/A B 1 VibroTact Arrow?	N/A	N/A B 2 VibroTact Arrow?	N/A				
N/A B 1 VibroTact Parallel to Xing?	N/A	N/A B 2 VibroTact Parallel to Xing?	N/A				
N/A B 1 VibroTact Contrast	N/A	N/A B 2 VibroTact Contrast	N/A				
No B 1 Pilot Light?	No	N/A B 2 Pilot Light?	N/A				
N/A B 1 Pilot Light Illumination?	N/A	N/A B 2 Pilot Light Illumination?	N/A				
N/A B 1 Walk Indicator Type	N/A	N/A B 2 Walk Indicator Type	N/A				
N/A B 1 Walk Indicator Audible?	N/A	N/A B 2 Walk Indicator Audible?	N/A				
N/A B 1 Locator Tone?	N/A	N/A B 2 Locator Tone?	N/A				
N/A B 1 Tone Audible Range?	N/A	N/A B 2 Tone Audible Range?	N/A				
B 1 Addl APS Features?	No	B 2 Addl APS Features?	N/A				
B 1 Addl APS Features Notes	N/A	B 2 Addl APS Features Notes	N/A				
				Compliance Description Data Compliance Description Data			
				Button Count Button1 Yes Distant to Additional Button (in) 281			
				Additional Button Present? Yes N/A Additional Button ID SGRK211130124519			
				Located In An Island/Median? No			
				N/A B 1 Sign Present? Yes N/A B 2 Sign Present? N/A			
				Yes B 1 Sign Purpose? Yes N/A B 2 Sign Purpose? N/A			
				Yes B 1 Sign Lettering & Contrast? Yes N/A B 2 Sign Lettering & Contrast? N/A			
				Yes B 1 Parallel To XWalk? Yes N/A B 2 Parallel To XWalk? N/A			
				N/A B 1 PAR to Button? N/A N/A B 2 PAR to Button? N/A			
				N/A B 1 PAR to XWalk? N/A N/A B 2 PAR to XWalk? N/A			
				Yes B 1 Clear Floor Space? Yes N/A B 2 Clear Floor Space? N/A			
				N/A B 1 FWD Approach? N/A N/A B 2 FWD Approach? N/A			
				N/A B 1 FWD Approach Constrained? N/A N/A B 2 FWD Approach Constrained? N/A			
				N/A B 1 FWD Approach Reach (in) N/A N/A B 2 FWD Approach Reach (in) N/A			
				N/A B 1 FWD Approach Width (in) N/A N/A B 2 FWD Approach Width (in) N/A			
				N/A B 1 FWD Approach Obstruction? N/A N/A B 2 FWD Approach Obstruction? N/A			
				N/A B 1 FWD Approach Obstruction Dist (in) N/A N/A B 2 FWD Approach ObstructionDist (in) N/A			
				N/A B 1 PARA Approach? N/A N/A B 2 PARA Approach? N/A			
				N/A B 1 PARA Approach Constrained? No N/A B 2 PARA Approach Constrained? N/A			
				Yes B 1 PARA Approach Reach (in) 0 N/A B 2 PARA Approach Reach (in) N/A			
				N/A B 1 PARA Approach Width (in) N/A N/A B 2 PARA Approach Width (in) N/A			
				N/A B 1 PARA Approach Obstruction? No N/A B 2 PARA Approach Obstruction? N/A			
				N/A B 1 PARA Approach Obstruction Dist (in) N/A N/A B 2 PARA Approach Obstruction Dist (in) N/A			
				Yes B 1 Clear Floor Space Slope (%) 0.9 N/A B 2 Clear Floor Space Slope (%) N/A			
				No B 1 Clear Floor Space XSlope (%) 4.6 N/A B 2 Clear Floor Space XSlope (%) N/A			
				N/A B 1 PAR Slope (%) 1.1 N/A B 2 PAR Slope (%) N/A			
				Yes B 1 Height (in) 40 N/A B 2 Height (in) N/A			
				Yes B 1 Pressure (#) 5 N/A B 2 Pressure (#) N/A			
				Yes B 1 Closed Fist Operation? Yes N/A B 2 Closed Fist Operation? N/A			
				Yes B 1 Diameter (in) 2 N/A B 2 Diameter (in) N/A			
				N/A B 1 Crossing Direction W N/A B 2 Crossing Direction N/A			
				Yes B 1 DistanceTo XWalk (in) 46 N/A B 2 DistanceTo XWalk (in) N/A			
				Yes B 1 DistanceTo Curb (in) 46 N/A B 2 DistanceTo Curb (in) N/A			
				Parcel Identification Number 755-451-12			
				Google Street View Link			
				http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.54635971,-117.59637527			