

## Access Compliance Report Public Rights-of-Way (Pedestrian Signals)



Data

SGRK211206155347

286

Yes

Yes

Yes

Yes

N/A

N/A

Yes

N/A

N/A

N/A

N/A

N/A

N/A

N/A

No

N/A

No

0

Main Street: SEAL\_BEACH\_BLVD Cross Street: ST\_CLOUD\_DR Location: NE

ADA ID: SGRK211206155549 Signal Type:One Push Button-Non APS Overall Compliance: No Severity Scores: BTN 1: 35 BTN 2: N/A No BTN: N/A

Compliance Description

Additional Button Present?

Yes B 1 Sign Lettering & Contrast?

N/A B 1 FWD Approach Constrained?

N/A B 1 FWD Approach Reach (in)

N/A B 1 FWD Approach Width (in)

N/A B 1 FWD Approach Obstruction?

**N/A** B 1 PARA Approach Constrained?

Yes B 1 PARA Approach Reach (in)

N/A B 1 PARA Approach Width (in)

N/A B 1 PARA Approach Obstruction?

N/A B 1 FWD Approach Obstruction Dist (in)

Located In An Island/Median?

**Button Count** 

N/A B 1 Sign Present?

Yes B 1 Sign Purpose?

N/A B 1 PAR to Button?

N/A B 1 PAR to XWalk?

N/A B 1 FWD Approach?

N/A B 1 PARA Approach?

Yes B 1 Parallel To XWalk?

Yes B 1 Clear Floor Space?

## Codes/Mitigation Info/Possible Solution

## Field Measurements/Component Compliance

Compliance Description

N/A Additional Button ID

N/A B 2 Sign Present?

N/A B 2 Sign Purpose?

N/A B 2 PAR to Button?

N/A B 2 PAR to XWalk?

N/A B 2 FWD Approach?

N/A B 2 PARA Approach?

N/A B 2 Parallel To XWalk?

N/A B 2 Clear Floor Space?

Yes Distant to Additional Button (in)

N/A B 2 Sign Lettering & Contrast?

N/A B 2 FWD Approach Constrained?

N/A B 2 FWD Approach Obstruction?

N/A B 2 PARA Approach Constrained?

N/A B 2 PARA Approach Reach (in)

N/A B 2 PARA Approach Width (in)

N/A B 2 PARA Approach Obstruction?

N/A B 2 FWD Approach ObstructionDist (in)

N/A B 2 FWD Approach Reach (in)

N/A B 2 FWD Approach Width (in)

Data

Button1

No


Yes

N/A

N/A

N/A

No

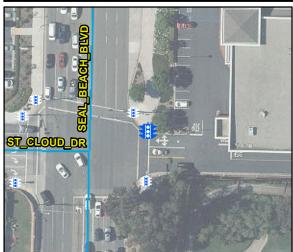

Possible Solutions: Replace Signal Push Button With APS Button. Remove and Replace Clear Space.

Surveyor Notes: Button 2 for Bike Lane

OC Std/PROW: R404.2, MUTCD 4e.08

Total Cost:

1278







APS Compliance				N/A B 1 PARA Approach Obstruction Dist	(in) <b>N/A</b>	N/A B 2 PARA Approach Obstruction Dist (i	in) <b>N/A</b>
N/A Is Button 1 APS or Non-APS?	NonAPS	N/A Is Button 2 APS or Non-APS?	NonAPS	Yes B 1 Clear Floor Space Slope (%)	0.7	N/A B 2 Clear Floor Space Slope (%)	5.9
N/A B 1 VibroTact Arrow?	N/A	N/A B 2 VibroTact Arrow?	N/A	No B 1 Clear Floor Space XSlope (%)	8.3	N/A B 2 Clear Floor Space XSlope (%)	0.2
N/A B 1 VibroTact Parallel to Xing?	N/A	N/A B 2 VibroTact Parallel to Xing?	N/A	N/A B 1 PAR Slope (%)	0.7	N/A B 2 PAR Slope (%)	4
N/A B 1 VibroTact Contrast	N/A	N/A B 2 VibroTact Contrast	N/A	Yes B 1 Height (in)	40	N/A B 2 Height (in)	39
No B 1 Pilot Light?	No	N/A B 2 Pilot Light?	No	Yes B 1 Pressure (#)	5	N/A B 2 Pressure (#)	5
N/A B 1 Pilot Light Illumination?	N/A	N/A B 2 Pilot Light Illumination?	N/A	Yes B 1 Closed Fist Operation?	Yes	N/A B 2 Closed Fist Operation?	Yes
N/A B 1 Walk Indicator Type	N/A	N/A B 2 Walk Indicator Type	N/A	Yes B 1 Diameter (in)	2	N/A B 2 Diameter (in)	2
N/A B 1 Walk Indicator Audible?	N/A	N/A B 2 Walk Indicator Audible?	N/A	N/A B 1 Crossing Direction	s	N/A B 2 Crossing Direction	w
N/A B 1 Locator Tone?	N/A	N/A B 2 Locator Tone?	N/A	Yes B 1 DistanceTo XWalk (in)	0	N/A B 2 DistanceTo XWalk (in)	0
N/A B 1 Tone Audible Range?	N/A	N/A B 2 Tone Audible Range?	N/A	Yes B 1 DistanceTo Curb (in)	29	N/A B 2 DistanceTo Curb (in)	57
B 1 Addl APS Features?	No	B 2 Addl APS Features?	No	Parcel Identification Number 1:	30-861-28		
B 1 Addl APS Features Notes	N/A	B 2 Addl APS Features Notes	N/A	Google Street View Link <a href="http://www.google.com/maps/@?api=1&amp;map_action=pano&amp;viewpoint=33.78041484,-118.07179287">http://www.google.com/maps/@?api=1↦_action=pano&amp;viewpoint=33.78041484,-118.07179287</a>			